
N13839 1970 Piper Turbo Aztec D

RH Engine Logbook SMOH | #1 of 2 1990 - 1991

MSN: 27-4480



Prepared by the worldwide aviation specialists at RidgeAire, Inc.

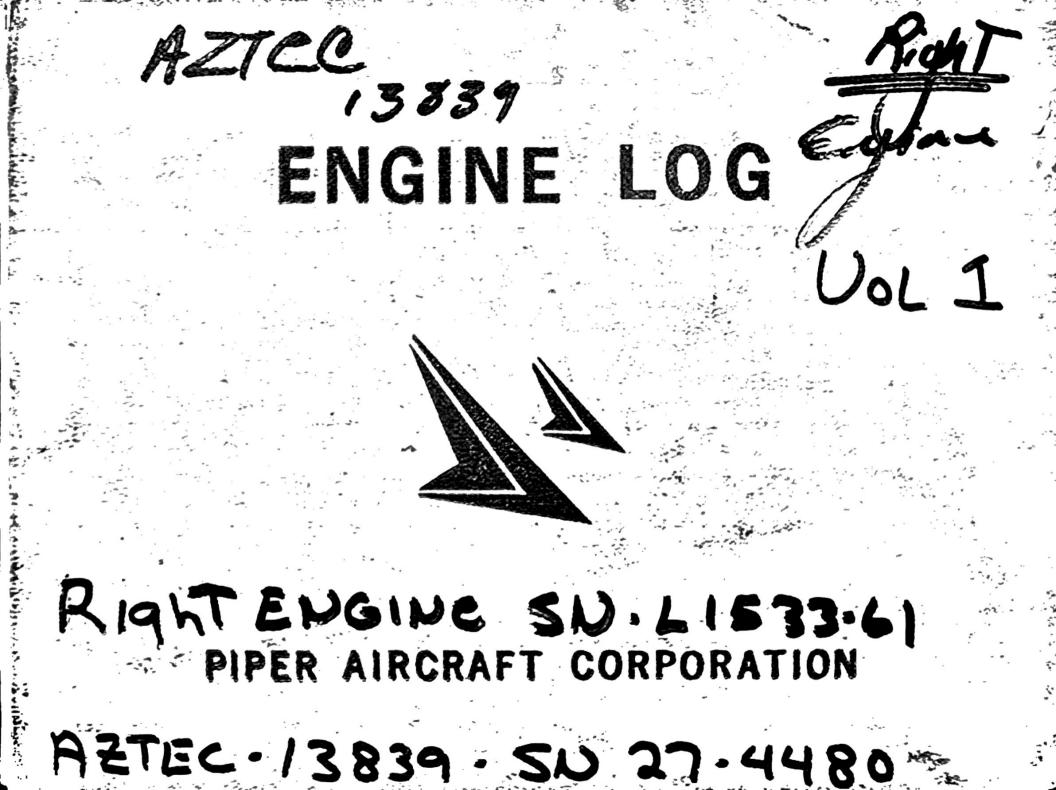

ENGINE LOG

BOOROM AIRCRAFT, INC.

Quality Aircraft Services

Since 1948

Carry Forward

816 Airport Road, Jackson, Michigan 49202 Telephone 517-784-AERO or 517-764-0485 Fax 517-784-0446

RIGHT ENGINE LOG N13839 S/N L-1533-61 Date: 11-20-90 Tach 1920.28 TSMOH 0.0 Removed right engine for overhaul. Replaced the following overhauled parts: (See yellow and overhaul tags) 2-ES10-349290-1 & 2-ES10-349310-1 Bendix Magnetos; 441CC-7 Vacuum pump; 1-2524223-2 Flow divider; 1-77830 Wastegate; 1-406610-9021 Turbocharger; 6-2523785 Injector nozzles; 1-LW 10682 Controller; 1-LW 10098 Controller; 1-2524359-10 Servo fuel injector and 6-76087 Cylinders. The following parts were replaced new: 6-SL75413 Piston; 1-76248 Camshaft; 12-72877 Cam followers; 1-SL75413 Ring set; 2-SL13884 Front main bearing; 6-LW10124 Main bearing; 12-SL13521 Conrod bearing;

Quality Aircraft Services

BOOROM AIRCRAFT, INC.

Since 1948

816 Airport Road, Jackson, Michigan 49202 Telephone 517-784-AERO or 517-764-0485 Fax 517-784-0446

 12-74644 Rod bolt; 12-SL12186 Rod nut; 1-STD-2209 Crank gear bolt; 1-SL67516 Crank gear lock tab; 1-73250 Spacer washer; 1-SL61297 Oil pump gear; 1-SL61298 Oil pump impellor; 12-0271371 Sparkplug; 1-M2792RH Mag harness; 2-SL67542 Mag bearing; 1pl1-4419 Air filter; 1-75845 Gasket; 1-78246 Gasket; 6-MS13998-3 Cap - valve stem; 1-AN6C10A Bolt; 2-STD2132 Nut. All steal parts were magnafluxed and inspected, camshaft and followers reground (see yellow tags). Engine reassembled and reinstalled on arcraft. Engine was test run and checked okay. All work done in accordance with

	ENGIN	e log		
Date		ecorder eading	Maintena	nce
BOORC	OM AIRCRAFT, INC.		Quality Aircraft Services	_
Since 1948		816 Airp Telepho	ort Road, Jackson, Michigan 49202 ne 517-784-AERO or 517-764-0485 Fax 517-784-0446	
Lycomin Manual	g Parts Catalog PC-315 60294-7. Engine approv	and ed fo	Lycoming Overhaul r return to	-
	after test flight.			
1	AP37	1542	159-FA	-
	END			_
				-
				-
				_
				-

SERVICEABLE

8

- L				
	ITEM DESCRIPTION		MFG.	
	Servo Fuel Inject	or		BX
	MODEL OR TYPE	ART	ND.	SERIAL NO.
	RSA5AD1	2	2524359-10	30621
	TYPE REPAIR ACCOMPLISHED			DATE
	MAJOR OVERHAUL			9/25/90
L	INSP. WORK ORDER NO.	□.	PRECISIO	N AIR INC.
	INSP. OR TEST IS REQUIRED IF IN STORAGE AFTER:		F.A.A. AIR AG	ENCY NO. 2029
	IF IN STURAGE AFTER.			ETERING CONTROLS Hebler) Carburetors
	CUSTOMER:		CENTRAL	DISTRIBUTOR
	Boorom Aircraft		3610 N. W. 41 ST.	& SERVICE
	CUSTOMER ORDER NO.		MIAMI, FLA. 33142	(305) 635-5293
		2		

LIMITED ACCESSORIES FAA APPROVED STATION NO. TB3R861L
Serving Every State In The United States SERVICEABLE SOUTHWEST COOLER SERVICE 3939 PLATINUM WAY DALLAS, TEXAS 75237 BOOROM Aircraft
CUSTOMERBOOLOM AILCIAIL Part NameController
Mfg. ByAiresearch
Part No LW10098
Serial No. 00394
Repaired By October 9, 1990
Insp. By

LIMITED ACCESSORIES FAA APPROVED STATION NO. TB3R861L



Serving Every State In The United States SERVICEABLE SOUTHWEST COOLER SERVICE 3939 PLATINUM WAY DALLAS, TEXAS 75237

CUSTOMER BOOROM Aircraft

 
Part Name_Turbocharger

Mfg. By____Airesearch____

Part No. 406610-9021

Serial No.__JFR0113_____

Repaired By



LIMITED ACCESSORIES FAA APPROVED STATION NO. T	
and the second	
	Every State In The United States SERVICEABLE NEST COOLER SERVICE 3939 PLATINUM WAY DALLAS, TEXAS 75237
CUSTOMER	Boorom Aircraft
Part Name	Wastegate
Mfg. By	Airesearch
Part No	77830
Serial No	03588
Repaired By	Mile 4
DateOC	tober 9, 1990
Insp. By	1000

. . *

.

LIMITED ACCESSORIES FAA APPROVED STATION NO. TB3R861L



Serving Every State In The United States SERVICEABLE SOUTHWEST COOLER SERVICE 3939 PLATINUM WAY DALLAS, TEXAS 75237

Boorom Aircraft CUSTOMER

Controller Part Name

Airesearch Mfg. By____

Part No._____ LW10682


Serial No. JGR0183

Repaired By_

Date October 9. Insp. By



SERVICEABLE

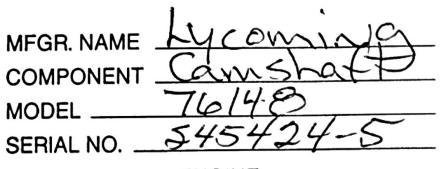

ENGINE

THE AIRCRAFT/COMPONENT IDENTI-FIED ABOVE WAS REPAIRED AND INSPECTED IN ACCORDANCE WITH CURRENT REGULATIONS OF THE FEDERAL AVIATION AGENCY AND IS APPROVED FOR RETURN TO SERVICE.

PERTINENT DETAILS OF THE REPAIR ARE ON FILE AT THIS REPAIR STATION UNDER WORK ORDER NO. 45424 DATE _________ SIGNED _________ SIGNED ________



FAA CERTIFIED REPAIR STATION NO. DD2R764K

SERVICEABLE LY-CON AVIATION, INC. F.A.A. Approved Repair Station 3270
Customer Boorom Aircraft
Part Name
Mfg. By Lycoming
Part No
Model <u>T10-540-CIA</u> serial No. <u>L-1533-61</u>
Condition
Remarks: Cleaned and magnaflux inspected
Crankshaft, 2 counterweights, 6 connecting rads
and caps, 2 idler gears, crank gear, 2 mg
drive gears, fuel pump idler gear and drive
gear, governor idler, drive and shaft gear,
vacuum pumpdrive gear, 6 piston pins,
6 rocker shafts, 12 rocker arms, and all pump
drive impeller:
Polished and dimensionally checked
Crankshaft SIZe (std) runout (OK). Installed counterweights on crankshaft.
+ "stalled counterweights on crankshaft,

FAA APPROVED REPAIR STATION # 202-191

MAINTENANCE RELEASE



· 1/ >

MAINTENANCE RELEASE

The aicraft and/or component identified hereon was repaired and inspected in accordance with current Federal Aviation Regulations and was found air worthy for return to service. Pertinent details of the repair are on file at this agency under Work Order

3245 No. Date Signed For ARRISON ENGINE SERVICE, INC. Gov't. Approved Repair Station #LR2R988K **301 DETROIT STREET** LAPORTE, INDIANA 46350

Phone: 219-362-9707 or 219-362-9925 1-800-348-0257 Fax 219-324-5395

The aicraft and/or component identified hereon was repaired and inspected in accordance with current Federal Aviation Regulations and was found air worthy for return to service. Pertinent details of the repair are on file at this agency under Work Order


3246 No. Date_10-22-90 Signed For

Gov'i. Approved Repair Station #LR2R988K

301 DETROIT STREET LAPORTE, INDIANA 46350 Phone: 219-362-9707 or 219-362-9925 1-800-348-0257 Fax 219-324-5395


The aicraft and/or component identified hereon was repaired and inspected in accordance with current Federal Aviation Regulations and was found air worthy for return to service. Pertinent details of the repair are on file at this agency under Work Order

3241 No.

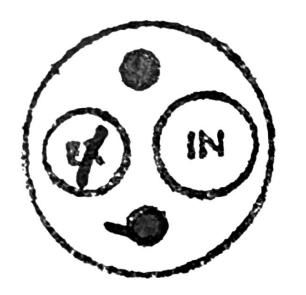

Date 10-22-90 Davial Jurner Signed

For

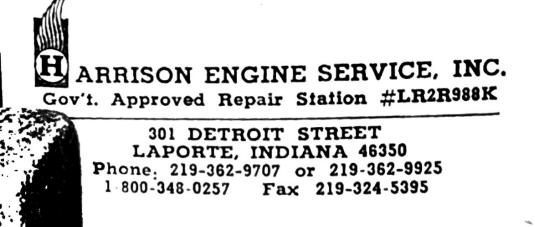




The aicraft and/or component identified hereon was repaired and inspected in accordance with current Federal Aviation Regulations and was found air worthy for return to service. Pertinent details of the repair are on file at this agency under Work Order

3248 No.




10-22 Date_ Signed

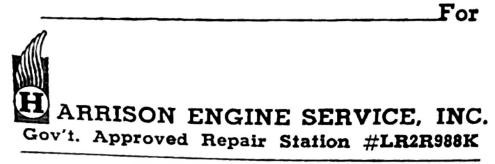

301 DETROIT STREET LAPORTE, INDIANA 46350 Phone: 219-362-9707 or 219-362-9925 1-800-348-0257 Fax 219-324-5395

The aicraft and/or component identified hereon was repaired and inspected in accordance with current Federal Aviation Regulations and was found air worthy for return to service. Pertinent details of the repair are on file at this agency under Work Order

324 No.

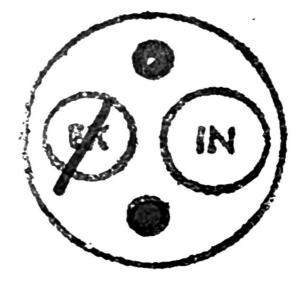

-22-90 Date Turn Signed


For

ARRISON ENGINE SERVICE, INC. Gov't. Approved Repair Station #LR2R988K 301 DETROIT STREET LAPORTE, INDIANA 46350 Phone. 219-362-9707 or 219-362-9925 Phone. 219-362-9707 or 219-362-9925


#6


The aicraft and/or component identified hereon was repaired and inspected in accordance with current Federal Aviation Regulations and was found air worthy for return to service. Pertinent details of the repair are on file at this agency under Work Order

250 No.

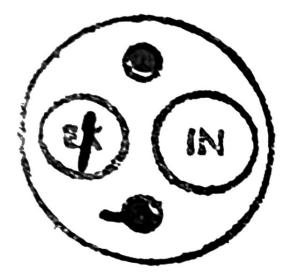


22-90 Date_ ial Jurne Signed

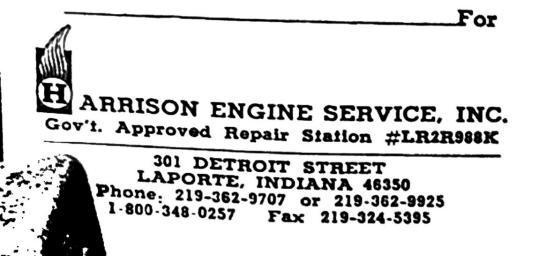


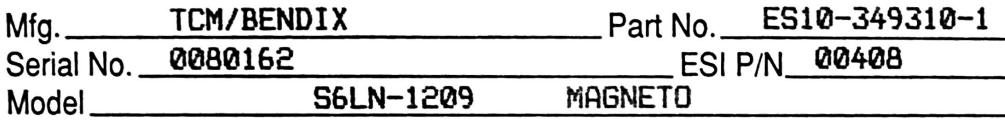

The aircraft, airframe, aircraft engine, propeller, or appliance identified above was overhauled and inspected in accordance with Current Regulations of the Federal Aviation Administration and is approved for return to service.

 
Pertinent details of the overhaul are on file at this repair station under:

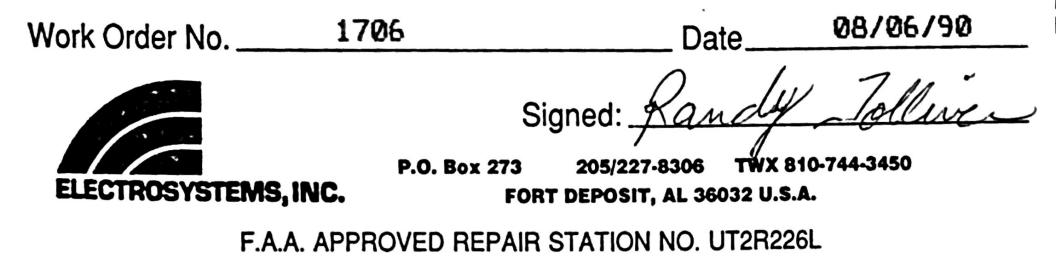



The aircraft, airframe, aircraft engine, propeller, or appliance identified above was overhauled and inspected in accordance with Current Regulations of the Federal Aviation Administration and is approved for return to service.

Pertinent details of the overhaul are on file at this repair station under:

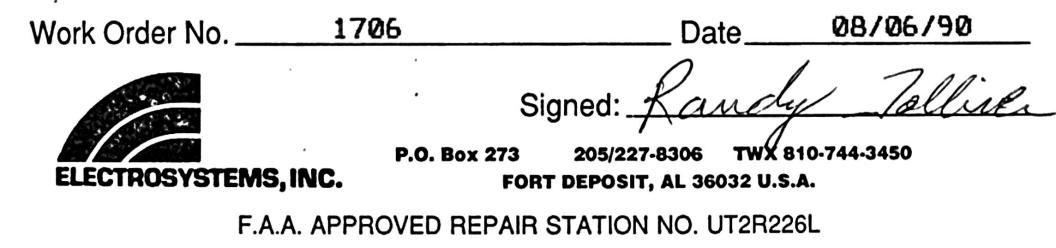







THIS UNIT IS OVERHAULED IN ACCORDANCE WITH CURRENT ORIGINAL EQUIPMENT MANU-UFACTURERS OVERHAUL MANUAL AND THE LATEST MANUFACTURERS SERVICE BULLETINS AND AIRWORTHINESS DIRECTIVES.

7

THIS UNIT IS OVERHAULED IN ACCORDANCE



WITH CURRENT ORIGINAL EQUIPMENT MANU-UFACTURERS OVERHAUL MANUAL AND THE

LATEST MANUFACTURERS SERVICE BULLETINS

AND AIRWORTHINESS DIRECTIVES.

S	SE1	RV	ICEAB	LE
les	ITEM DESCRIPTION			MFG.
NN	Flow Divider	I BX		
Nozz I	MODEL OR TYPE	PAR	T ND.	SERIAL NO.
		25	24223-2	3535
ea)	TYPE REPAIR ACCOMPLISH	ED		DATE
6 85	MAJOR OVERHAUL			9/25/90
U M U	INSP. WORK ORDER	ND.		
0H(523	57961		PRECISIO	DN AIR INC.
~ ~	INSP. OR TEST IS REQUIRED		F.A.A. AIR AG	BENCY NO. 2029
Г х				ETERING CONTROLS
Al P/	CUSTOMER:			HEBLER) CARBURETORS DISTRIBUTOR
	Boorom Aircraft			& SERVICE
	CUSTOMER ORDER NO.		MIAMI, FLA. 33142	(305) 635-5293

\$ -

salara a a Manasarata

t




Airport Complex PO Box 273 Fort Deposit, Alabama 36032 USA 205/227-8306 TWX 810-744-3450

WARRANTY DATA CARD

The following information must be supplied when requesting warranty consideration:

BENDIX	10-349290-1	80162
MFR	P/N	S/N

 

DATE REMOVED


ITH AIRCRAFT LOG BOOK



TACH TIME

ARD OWNERS NAME 5572 ATIC 20. ADDRESS

PHONE

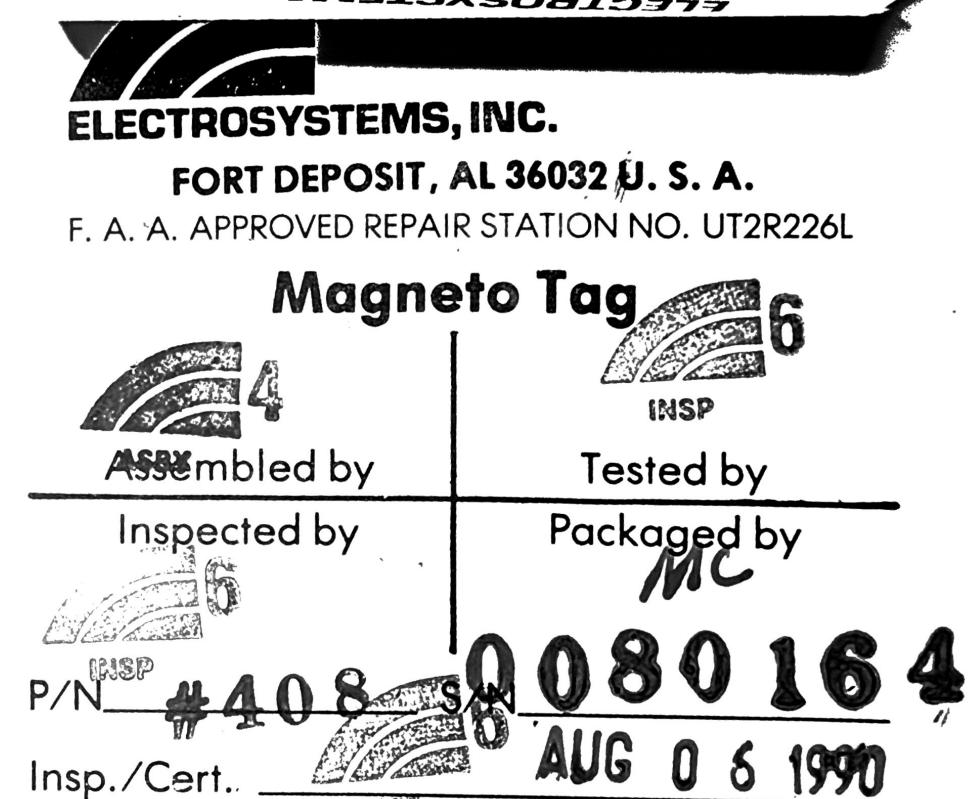

SLICK SLICK FAA/PMA APPROVED HIGH TEMPERATURE **AIRCRAFT HARNESS** PART NO. M2792RH

The aircraft, airframe, aircraft engine, propeller, or appliance identified above was repaired and inspected in accordance with current regulations of the Federal Aviation Agency and is approved for return to service. PERTINENT DETAILS OF THE REPAIR ARE ON FILE AT THIS

AGENCY UNDER WORK ORDER NO.

DATE SIGNED David W Stoner FOR KEYSTONE INSTRUMENTS, INC. Municipal Airport INSTRUMENT CLASS 1 P. O. BOX 2 LOCK HAVEN, PA.

Form 100-B

MIKe		te No
BOOROM AIRCRAFT, INC	Quality Aircraft Services	
Since 1948	816 Airport Road, Jackson, Michigan 49202 Telephone 517-784-AERO or 517-764-0485 Fax 517-784-0446	
	Date: 11-20-90 Tach 1920.28	
Removed starting vibrator an serviceable unit P/N 10-1764 ran and checked okay. Aircra to service after test flight	487-122. Aircraft test aft approved for return	
	0371512159FA	
ENI)	:

فسيتصفقوهما فالعفار المستقابين والتأثيفات الأرار الاستعاد التأوين والارا

Marine Charles

ENGINE LOG

Y

with - printer a

Date	Engin	e Time	Recorder	/		1
Udie	This Date	Since Major	Reading	Maintenance	Signature	Certificate N
	Brought Forward			}		
Jaus,991	1940.0	IZhas	1940.0	JAN 5, 1991 C/WHANNA	Fuspection Piper	
				MAintenner MANUAC, AU	Inspection Piper Cylindars to on better @ 12HAs 656-30 Non det 10 gts	
	1			SMOH. Changel oil	45w-30 Non det 10 gts	
				Inspected Rat Pay	TT 1940.0 Als All TO ONTE SHT. stactory End	
				KUN UP a Checkel	SAT. stactory End	
				(I ceatify this Engines & Anaf Has	
					BEED Inspected in Accordance With HANNAL Inspection And. Was determined To Be in Airwary.	
				•	With HARVAC Inspection And.	
Total To				· · · · · · · · · · · · · · · · · · ·	was determined To Be in Armorry.	
Carry Forward					Canditian. Date: 1-5-11 Signature Philo A 3_ Gert: Inter 316525369 IA	
					Gert: 1-110# 316525369 IA	

.

. ..

....

