



JetPros

231 Terminal Circle
Longview, Texas 75603
Email: mx@jetpros.com
Phone: 903-309-4687
jetpros.com

Date: 08-14-2025
Reg. No.: N6822U
Quote No.: Q1003-07-2025 (1981 Cessna 414A)
A/C Serial: 414A0808
Engine 2 Make: Continental
Engine 2 Model: TSIO-520-NB
Engine 2 SN: 290542-R
Hobbs: 4004.2
Engine TT: 2287.6
Engine TSMO : 746.7

Bill to: KW AIRCRAFT LLC
PO BOX 626
JUDSON, TX 75660-0626 USA

Item: 1-Airworthy Airframe

AUTHORIZED ☒ Yes ☐ No

Discrepancy

Annual inspection is due.

Hours **Subtotal**
Flat \$8,000.00

Item Summary	Labor: \$8,000.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$8,000.00
---------------------	--------------------------	----------------------	-------------------------	----------------------------------

Item: 2-Airworthy Airframe

AUTHORIZED ☒ Yes ☐ No

Discrepancy

Airframe Annual Inspection.

Hours **Subtotal**
N/C-*** \$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
---------------------	----------------------	----------------------	-------------------------	------------------------------

Item: 3-Airworthy Airframe

AUTHORIZED ☒ Yes ☐ No

Discrepancy

Perform ELT inspection in accordance with CFR 91.207 (d).

Hours **Subtotal**
N/C-*** \$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
---------------------	----------------------	----------------------	-------------------------	------------------------------

Item: 4-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

ELT battery expired in 2023.

Hours **Subtotal**
0.50 \$70.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	BP-1020	ELT Battery		\$159.12	\$159.12
Item Summary					Labor: \$70.00
		Parts: \$159.12	Shipping: \$0.00	Item Subtotal: \$229.12	

Item: 5-Airworthy Airframe

AUTHORIZED ☒ Yes ☐ No

Discrepancy

Airframe AD compliance review.

Hours **Subtotal**
N/C-*** \$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
---------------------	----------------------	----------------------	-------------------------	------------------------------

Item: 6-Airworthy Airframe

AUTHORIZED ☒ Yes ☐ No

Discrepancy

Main ship battery capacity check.

Hours **Subtotal**
N/C-*** \$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
---------------------	----------------------	----------------------	-------------------------	------------------------------

Item: 7-Airworthy Airframe

AUTHORIZED ☒ Yes ☐ No

Discrepancy

Flight control cable tension check.

Hours	Subtotal
N/C-***	\$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
--------------	---------------	---------------	------------------	-----------------------

Item: 8-Airworthy Airframe

AUTHORIZED ☒ Yes ☐ No

Discrepancy

Flight control surface travel check.

Hours	Subtotal
N/C-***	\$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
--------------	---------------	---------------	------------------	-----------------------

Item: 9-Airworthy Airframe

AUTHORIZED ☒ Yes ☐ No

Discrepancy

Fire extinguisher weight and visual inspection.

Hours	Subtotal
N/C-***	\$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
--------------	---------------	---------------	------------------	-----------------------

Item: 10-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

Fire extinguisher requires hydrostatic check or replacement.

Hours	Subtotal
0.25	\$35.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	C352TS	Fire Extinguisher		\$628.49	\$628.49

Item Summary	Labor: \$35.00	Parts: \$628.49	Shipping: \$0.00	Item Subtotal: \$663.49
--------------	----------------	-----------------	------------------	-------------------------

Item: 11-Airworthy Airframe

AUTHORIZED ☒ Yes ☐ No

Discrepancy

Landing gear wheel bearing cleaning and repack with fresh grease.

Hours	Subtotal
N/C-***	\$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
--------------	---------------	---------------	------------------	-----------------------

Item: 12-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

Airframe fuel strainer cleaning and inspection is due.

Hours	Subtotal
N/C	\$0.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
2	MS29512-05	O-Ring		\$11.22	\$22.44
2	MS29513-237	O-Ring		\$2.68	\$5.36

Item Summary	Labor: \$0.00	Parts: \$27.80	Shipping: \$0.00	Item Subtotal: \$27.80
--------------	---------------	----------------	------------------	------------------------

Item: 13-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

Heater fuel strainer cleaning is due.

Hours	Subtotal
N/C	\$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
--------------	---------------	---------------	------------------	-----------------------

Item: 14-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

Heater fuel filter bowl gasket is deteriorated and cracked.

Hours	Subtotal
N/C	\$0.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	MS29513-125	O-Ring		\$2.87	\$2.87

Item Summary	Labor: \$0.00	Parts: \$2.87	Shipping: \$0.00	Item Subtotal: \$2.87
--------------	---------------	---------------	------------------	-----------------------

Item: 15-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

Air conditioning system hydraulic filter replacement is due.

	Hours	Subtotal
	N/C	\$0.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	AN6235-3A	Filter		\$17.05	\$17.05
1	MS28775-226	O-Ring		\$5.22	\$5.22

Item Summary	Labor: \$0.00	Parts: \$22.27	Shipping: \$0.00	Item Subtotal: \$22.27
--------------	---------------	----------------	------------------	------------------------

Item: 16-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

Hydraulic system filter replacement is due.

	Hours	Subtotal
	N/C	\$0.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
2	AN6235-2A	Filter		\$19.87	\$39.74
2	AN6246-27	Gasket		\$12.28	\$24.56
2	MS28775-114	O-Ring		\$1.13	\$2.26
2	MS28775-222	O-Ring		\$2.96	\$5.92

Item Summary	Labor: \$0.00	Parts: \$72.48	Shipping: \$0.00	Item Subtotal: \$72.48
--------------	---------------	----------------	------------------	------------------------

Item: 17-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

Hydraulic reservoir is low on fluid.

	Hours	Subtotal
	N/C	\$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
--------------	---------------	---------------	------------------	-----------------------

Item: 18-Airworthy Engine

AUTHORIZED ☒ Yes ☐ No

Discrepancy

Left engine 100 hr inspection.

	Hours	Subtotal
	N/C-***	\$0.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	649983	Gasket		\$2.06	\$2.06
1	MS35769-11	Gasket		\$0.99	\$0.99
1	MS9021-150	O-Ring		\$26.58	\$26.58

Item Summary	Labor: \$0.00	Parts: \$29.63	Shipping: \$0.00	Item Subtotal: \$29.63
--------------	---------------	----------------	------------------	------------------------

Item: 19-Airworthy Engine

AUTHORIZED ☒ Yes ☐ No

Discrepancy

Left engine compression check.

	Hours	Subtotal
	N/C-***	\$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
--------------	---------------	---------------	------------------	-----------------------

Item: 20-Airworthy Engine

AUTHORIZED ☒ Yes ☐ No

Discrepancy

Left engine oil change and oil filter inspection.

	Hours	Subtotal
	N/C-***	\$0.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
12	550050837	W100 Plus		\$14.76	\$177.12
1	AA48108-2	Oil Filter		\$44.95	\$44.95
1	AOA1151P-PPD	Basic Oil Analysis Kit		\$33.60	\$33.60

Item Summary	Labor: \$0.00	Parts: \$255.67	Shipping: \$0.00	Item Subtotal: \$255.67
---------------------	----------------------	------------------------	-------------------------	--------------------------------

Item: 21-Airworthy Engine
 AUTHORIZED ☒ Yes ☐ No
Discrepancy

Left engine spark plug cleaning and inspection.

Hours	Subtotal
N/C-***	\$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
---------------------	----------------------	----------------------	-------------------------	------------------------------

Item: 22-Airworthy Engine
 AUTHORIZED ☒ Yes ☐ No
Discrepancy

Left engine fuel injector cleaning is due.

Hours	Subtotal
N/C	\$0.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
12	630979-9	O-Ring		\$4.54	\$54.48
6	633958-3	Seal		\$2.45	\$14.70
6	640612	TCM Washer		\$1.16	\$6.96

Item Summary	Labor: \$0.00	Parts: \$76.14	Shipping: \$0.00	Item Subtotal: \$76.14
---------------------	----------------------	-----------------------	-------------------------	-------------------------------

Item: 23-Airworthy Engine
 AUTHORIZED ☒ Yes ☐ No
Discrepancy

Perform left engine cylinder borescope.

Hours	Subtotal
2.00	\$280.00

Item Summary	Labor: \$280.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$280.00
---------------------	------------------------	----------------------	-------------------------	--------------------------------

Item: 24-Airworthy Engine
 AUTHORIZED ☒ Yes ☐ No
Discrepancy

Left engine air oil separator cleaning and inspection is due.

Hours	Subtotal
N/C	\$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
---------------------	----------------------	----------------------	-------------------------	------------------------------

Item: 25-Airworthy Engine
 AUTHORIZED ☒ Yes ☐ No
Discrepancy

Left engine magneto timing validation.

Hours	Subtotal
N/C-***	\$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
---------------------	----------------------	----------------------	-------------------------	------------------------------

Item: 26-Airworthy Engine
 AUTHORIZED ☒ Yes ☐ No
Discrepancy

Left engine AD compliance review.

Hours	Subtotal
N/C-***	\$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
---------------------	----------------------	----------------------	-------------------------	------------------------------

Item: 27-Airworthy Engine
 AUTHORIZED ☒ Yes ☐ No
Discrepancy

Right engine 100hr inspection.

Hours	Subtotal
N/C-***	\$0.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	649983	Gasket		\$2.06	\$2.06
1	MS35769-11	Gasket		\$0.99	\$0.99
1	MS9021-150	O-Ring		\$26.58	\$26.58

Item Summary	Labor: \$0.00	Parts: \$29.63	Shipping: \$0.00	Item Subtotal: \$29.63
---------------------	----------------------	-----------------------	-------------------------	-------------------------------

Item: 28-Airworthy EngineAUTHORIZED ☒ Yes ☐ No**Discrepancy**

Right engine compression check.

Hours	Subtotal
N/C-***	\$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
---------------------	----------------------	----------------------	-------------------------	------------------------------

Item: 29-Airworthy EngineAUTHORIZED ☒ Yes ☐ No**Discrepancy**

Right engine oil change and oil filter inspection.

Hours	Subtotal
N/C-***	\$0.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
12	550050832	W100 SAE 50		\$13.83	\$165.96
1	AA48108-2	Oil Filter		\$44.95	\$44.95
1	AOA1151P-PPD	Basic Oil Analysis Kit		\$33.60	\$33.60
<hr/>					
Item Summary	Labor: \$0.00	Parts: \$244.51	Shipping: \$0.00	Item Subtotal: \$244.51	

Item: 30-Airworthy EngineAUTHORIZED ☒ Yes ☐ No**Discrepancy**

Right engine spark plug cleaning and inspection.

Hours	Subtotal
N/C-***	\$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
---------------------	----------------------	----------------------	-------------------------	------------------------------

Item: 31-Airworthy EngineAUTHORIZED ☒ Yes ☐ No**Discrepancy**

Right engine fuel injector cleaning is due.

Hours	Subtotal
N/C	\$0.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
12	630979-9	O-Ring		\$4.54	\$54.48
6	633958-3	Seal		\$2.45	\$14.70
6	640612	TCM Washer		\$1.16	\$6.96
<hr/>					
Item Summary	Labor: \$0.00	Parts: \$76.14	Shipping: \$0.00	Item Subtotal: \$76.14	

Item: 32-Airworthy EngineAUTHORIZED ☒ Yes ☐ No**Discrepancy**

Perform right engine cylinder borescope.

Hours	Subtotal
2.00	\$280.00

Item Summary	Labor: \$280.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$280.00
---------------------	------------------------	----------------------	-------------------------	--------------------------------

Item: 33-Airworthy EngineAUTHORIZED ☒ Yes ☐ No**Discrepancy**

Right engine air oil separator cleaning and inspection is due.

Hours	Subtotal
N/C	\$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
---------------------	----------------------	----------------------	-------------------------	------------------------------

Item: 34-Airworthy EngineAUTHORIZED ☒ Yes ☐ No**Discrepancy**

Right engine magneto timing validation.

Hours	Subtotal
N/C-***	\$0.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	649954	Gasket: Magneto, Rubber		\$1.86	\$1.86
<hr/>					
Item Summary	Labor: \$0.00	Parts: \$1.86	Shipping: \$0.00	Item Subtotal: \$1.86	

Item: 35-Airworthy Engine

AUTHORIZED ☒ Yes ☐ No

Discrepancy					Hours	Subtotal
Right engine AD compliance review.					N/C-***	\$0.00
Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00	

Item: 36-Airworthy Propeller

AUTHORIZED ☒ Yes ☐ No

Discrepancy					Hours	Subtotal
Left propeller 100hr inspection.					N/C-***	\$0.00
Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00	

Item: 37-Airworthy Propeller

AUTHORIZED ☒ Yes ☐ No

Discrepancy					Hours	Subtotal
Left propeller lubrication.					N/C-***	\$0.00
Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00	

Item: 38-Airworthy Propeller

AUTHORIZED ☒ Yes ☐ No

Discrepancy					Hours	Subtotal
Left propeller AD compliance review.					N/C-***	\$0.00
Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00	

Item: 39-Airworthy Propeller

AUTHORIZED ☒ Yes ☐ No

Discrepancy					Hours	Subtotal
Right propeller 100hr inspection.					N/C-***	\$0.00
Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00	

Item: 40-Airworthy Propeller

AUTHORIZED ☒ Yes ☐ No

Discrepancy					Hours	Subtotal
Right propeller lubrication.					N/C-***	\$0.00
Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00	

Item: 41-Airworthy Propeller

AUTHORIZED ☒ Yes ☐ No

Discrepancy					Hours	Subtotal
Right propeller AD compliance review.					N/C-***	\$0.00
Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00	

Item: 42-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy					Hours	Subtotal
Central instrument air intake filter replacement is due.					0.50	\$70.00
Qty	Part Number	Description	Serial Number	Unit Price	Subtotal	
1	AA103435IA	Instrument air filter		\$119.96	\$119.96	
Item Summary	Labor: \$70.00	Parts: \$119.96	Shipping: \$0.00	Item Subtotal:	\$189.96	

Item: 43-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No**Discrepancy**

Vacuum regulator filters are due for replacement.

Hours	Subtotal
N/C	\$0.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
2	ARB3-5-1	Filter		\$4.63	\$9.26

Item Summary	Labor: \$0.00	Parts: \$9.26	Shipping: \$0.00	Item Subtotal: \$9.26
---------------------	----------------------	----------------------	-------------------------	------------------------------

Item: 44-Airworthy AirframeAUTHORIZED ☒ Yes ☐ No**Discrepancy**

Compile STC and STC supporting documentation list for aircraft

Hours	Subtotal
Flat	\$500.00

Item Summary	Labor: \$500.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$500.00
---------------------	------------------------	----------------------	-------------------------	--------------------------------

Item: 45-Airworthy AirframeAUTHORIZED ☒ Yes ☐ No**Discrepancy**

Compile special inspection status list for aircraft.

Hours	Subtotal
Flat	\$750.00

Item Summary	Labor: \$750.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$750.00
---------------------	------------------------	----------------------	-------------------------	--------------------------------

Item: 46-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No**Discrepancy**

FAA 91.411-.413 inspection is due. Aerosmith Aviation.

Hours	Subtotal
N/C	\$1,440.00

Outside Repair

Labor: \$1,440.00, Parts: \$0.00, Part No: 91.411 91.413 Cost to perform bi annual transponder and pitot static and altimeter checks.

Item Summary	Labor: \$1,440.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$1,440.00
---------------------	--------------------------	----------------------	-------------------------	----------------------------------

Item: 47-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No**Discrepancy**

AD 84-20-02 is due. Nose Landing Gear.

Hours	Subtotal
2.00	\$280.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	MS29513-125	O-Ring		\$2.87	\$2.87
1	SK421-121A	Service kit nose landing gear actuator rod end replacement.		\$214.88	\$214.88

Item Summary	Labor: \$280.00	Parts: \$217.75	Shipping: \$0.00	Item Subtotal: \$497.75
---------------------	------------------------	------------------------	-------------------------	--------------------------------

Item: 48-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No**Discrepancy**

AD 95-09-13 is due. Fuel Inlet Float Valve.

Hours	Subtotal
16.00	\$2,240.00

Item Summary	Labor: \$2,240.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$2,240.00
---------------------	--------------------------	----------------------	-------------------------	----------------------------------

Item: 49-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No**Discrepancy**

AD 97-01-13 is due. Fuel, Oil and Hydraulic Hoses

Hours	Subtotal
1.00	\$140.00

Item Summary	Labor: \$140.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$140.00
---------------------	------------------------	----------------------	-------------------------	--------------------------------

Item: 50-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No

Discrepancy					Hours	Subtotal
AD 2000-01-16 para. (b), (c), (e), and partial para. (g) is due. Exhaust System					16.00	\$2,240.00
Qty	Part Number	Description	Serial Number	Unit Price	Subtotal	
4	1001-3	Slip Joint		\$503.10	\$2,012.40	
4	1001-6	Spring Kit		\$111.54	\$446.16	
1	1995-1	LH elbow		\$1,882.80	\$1,882.80	
1	1995-2	RH Elbow		\$1,882.80	\$1,882.80	
2	2274-50	Clamp		\$374.10	\$748.20	
2	2274-60	Clamp		\$374.10	\$748.20	
Item Summary		Labor: \$2,240.00	Parts: \$7,720.56	Shipping: \$0.00	Item Subtotal:	\$9,960.56

Item: 51-Airworthy Airframe

 AUTHORIZED ☐ Yes ☐ No

Discrepancy					Hours	Subtotal
AD 2016-17-08 is due. Elevator Tab Control System					0.50	\$70.00
Item Summary		Labor: \$70.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$70.00

Item: 52-Airworthy Airframe

 AUTHORIZED ☐ Yes ☐ No

Discrepancy					Hours	Subtotal
AD 2004-21-05 air pressure switch replacement is due. The installed switch does not satisfy the requirements of the AD.					2.00	\$280.00
Qty	Part Number	Description	Serial Number	Unit Price	Subtotal	
1	94E42-2	Air pressure switch		\$504.84	\$504.84	
Item Summary		Labor: \$280.00	Parts: \$504.84	Shipping: \$0.00	Item Subtotal:	\$784.84

Item: 53-Airworthy Airframe

 AUTHORIZED ☐ Yes ☐ No

Discrepancy					Hours	Subtotal
AD 2004-25-16 R1 is due. Fuel regulator shutoff valve.					1.00	\$140.00
Item Summary		Labor: \$140.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$140.00

Item: 54-Airworthy Airframe

 AUTHORIZED ☐ Yes ☐ No

Discrepancy					Hours	Subtotal
SA4943SW: RAM winglet installation ICA's are due.					3.00	\$420.00
Item Summary		Labor: \$420.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$420.00

Item: 55-Airworthy Airframe

 AUTHORIZED ☐ Yes ☐ No

Discrepancy					Hours	Subtotal
SA4331SW: RAM exhaust slip joints and hardware ICA's are due. Complied with during AD, this is simply here for logbook purposes.					N/C	\$0.00
Item Summary		Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$0.00

Item: 56-Airworthy Airframe

 AUTHORIZED ☐ Yes ☐ No

Discrepancy					Hours	Subtotal
Garmin GA series antenna ICA's are due.					0.50	\$70.00
Item Summary		Labor: \$70.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$70.00

Item: 57-Airworthy Airframe

 AUTHORIZED ☐ Yes ☐ No

Discrepancy

SA4913NM: "Power Pac" Spoilers Kit Model SP4000 12 month/100 hour ICA's are due.

Hours	Subtotal
1.00	\$140.00

Item Summary	Labor: \$140.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$140.00
--------------	-----------------	---------------	------------------	-------------------------

Item: 58-Airworthy Airframe

AUTHORIZED	<input type="checkbox"/> Yes	<input type="checkbox"/> No
------------	------------------------------	-----------------------------

Discrepancy

SA01933LA-D: Garmin GNS 530W 12 month and 10 year ICA's are due.

Hours	Subtotal
1.00	\$140.00

Item Summary	Labor: \$140.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$140.00
--------------	-----------------	---------------	------------------	-------------------------

Item: 59-Airworthy Airframe

AUTHORIZED	<input type="checkbox"/> Yes	<input type="checkbox"/> No
------------	------------------------------	-----------------------------

Discrepancy

SA01933LA-D: Garmin GNS 430W 12 month and 10 year ICA's are due.

Hours	Subtotal
1.00	\$140.00

Item Summary	Labor: \$140.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$140.00
--------------	-----------------	---------------	------------------	-------------------------

Item: 60-Airworthy Airframe

AUTHORIZED	<input type="checkbox"/> Yes	<input type="checkbox"/> No
------------	------------------------------	-----------------------------

Discrepancy

SA01714WI: Garmin GTX 345 Installation 12 month and 10 year ICA's are due.

Hours	Subtotal
1.00	\$140.00

Item Summary	Labor: \$140.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$140.00
--------------	-----------------	---------------	------------------	-------------------------

Item: 61-Airworthy Airframe

AUTHORIZED	<input type="checkbox"/> Yes	<input type="checkbox"/> No
------------	------------------------------	-----------------------------

Discrepancy

SA10822SC: Aspen Evolution 2000 C3 installation ICA's are due. EFD and MFD internal batteries and emergency backup battery due its 4 year replacement.

Hours	Subtotal
3.00	\$420.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	409-00003-002	Battery		\$353.91	\$353.91
1	910-00001-009	EFD1000 Multi-function Display		\$3,594.00	\$3,594.00
Item Summary					Labor: \$420.00
					Parts: \$3,947.91
					Shipping: \$0.00
					Item Subtotal: \$4,367.91

Item: 62-Airworthy Airframe

AUTHORIZED	<input type="checkbox"/> Yes	<input type="checkbox"/> No
------------	------------------------------	-----------------------------

Discrepancy

O2 bottle is empty and hydrostatic inspection is due.

Hours	Subtotal
1.00	\$1,370.00

Outside Repair

Labor: \$231.60, Parts: \$0.00, Part No: 801365-10 Oxygen Bottle

, Labor: \$998.40, Parts: \$0.00, Part No: 801366-15 Oxygen Bottle Regulator

Item Summary	Labor: \$1,370.00	Parts: \$0.00	Shipping: \$360.00	Item Subtotal: \$1,730.00
--------------	-------------------	---------------	--------------------	---------------------------

Item: 63-Airworthy Airframe

AUTHORIZED	<input type="checkbox"/> Yes	<input type="checkbox"/> No
------------	------------------------------	-----------------------------

Discrepancy

Compass has no fluid and requires replacement.

Hours	Subtotal
1.00	\$140.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	5119405-5	Compass card		\$42.80	\$42.80
1	C660501-0401	Compass assembly		\$838.85	\$838.85
2	MS35218-28	Screw		\$7.75	\$15.50
Item Summary					Labor: \$140.00
					Parts: \$897.15
					Shipping: \$0.00
					Item Subtotal: \$1,037.15

Item: 64-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

Cabin pressurize/de-pressurize switch is broken and requires replacement.

Hours **Subtotal**
0.75 \$105.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	MTL-206N	Switch		\$58.99	\$58.99

Item Summary **Labor:** \$105.00 **Parts:** \$58.99 **Shipping:** \$0.00 **Item Subtotal:** \$163.99

Item: 65-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

Four dimming lighting sliders at broken and missing knobs.

Hours **Subtotal**
4.00 \$560.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	5118424-3	Light Dimmer Assy		\$374.10	\$374.10

Item Summary **Labor:** \$560.00 **Parts:** \$374.10 **Shipping:** \$0.00 **Item Subtotal:** \$934.10

Item: 66-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

Prop de-ice amps show lower than the green arc. Troubleshoot.

Hours **Subtotal**
2.00 \$280.00

Item Summary **Labor:** \$280.00 **Parts:** \$0.00 **Shipping:** \$0.00 **Item Subtotal:** \$280.00

Item: 67-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

Brakes are spongy and require bleeding/servicing.

Hours **Subtotal**
3.00 \$420.00

Item Summary **Labor:** \$420.00 **Parts:** \$0.00 **Shipping:** \$0.00 **Item Subtotal:** \$420.00

Item: 68-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

RH throttle is stiff and very hard to move.

Hours **Subtotal**
N/C \$0.00

Item Summary **Labor:** \$0.00 **Parts:** \$0.00 **Shipping:** \$0.00 **Item Subtotal:** \$0.00

Item: 69-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

Replace all landing gear tires and tubes due to dry rotting.

Hours **Subtotal**
4.00 \$560.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
2	302-039-402	6.50-10, tube Goodyear		\$184.96	\$369.92
1	302-246-401	G15/6.00-6		\$166.60	\$166.60
1	606C66-8	6.00-6 6 Ply		\$388.94	\$388.94
2	650C86-3	6.5x10 Tire, Goodyear FC III, 8 PR		\$561.79	\$1,123.58

Item Summary **Labor:** \$560.00 **Parts:** \$2,049.04 **Shipping:** \$0.00 **Item Subtotal:** \$2,609.04

Item: 70-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

Nose DME antenna exterior coating is flaking and the shell is cracked.

Hours **Subtotal**
1.00 \$140.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	CI-102	DME antenna		\$270.45	\$270.45

Item Summary **Labor:** \$140.00 **Parts:** \$270.45 **Shipping:** \$0.00 **Item Subtotal:** \$410.45

Item: 71-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No**Discrepancy**

Cockpit relief tube drain is clogged.

Hours	Subtotal
0.25	\$35.00

Item Summary	Labor: \$35.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$35.00
--------------	----------------	---------------	------------------	------------------------

Item: 72-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No**Discrepancy**

LH wing nacelle lower surface, forward of GPU plug have large missing paint chip with bare aluminum that have corrosion on it.

Hours	Subtotal
8.00	\$1,120.00

Item Summary	Labor: \$1,120.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$1,120.00
--------------	-------------------	---------------	------------------	---------------------------

Item: 73-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No**Discrepancy**

Aileron trim tab fails end play check and requires actuator replacement.

Hours	Subtotal
10.00	\$1,400.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	5115540-3	Aileron Trim Tab Actuator		\$1,814.12	\$1,814.12
1	CORE CHARGE	Returned unit P/N 5115540-3 is subject to up to \$4,500 core charge if it fails to meet the minimum core requirements.		\$0.00	\$0.00

Item Summary	Labor: \$1,400.00	Parts: \$1,814.12	Shipping: \$300.00	Item Subtotal: \$3,514.12
--------------	-------------------	-------------------	--------------------	---------------------------

Item: 74-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No**Discrepancy**

LH wing upper surface square panel is leaking fuel from a screw.

Hours	Subtotal
4.00	\$560.00

Item Summary	Labor: \$560.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$560.00
--------------	-----------------	---------------	------------------	-------------------------

Item: 75-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No**Discrepancy**

LH wing has fuel leaking at wing tip, between wing and the winglet structure. (Requires left outboard boot to be removed to repaired)

Hours	Subtotal
40.00	\$5,600.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
4	50FC-428	Nut		\$77.38	\$309.52
1	74-451-11	A-56-BR-1 Sealing Compound, 1/2 pint		\$84.90	\$84.90
2	74-451-207	FASTBOOT PRIMER, 1/2 PINT		\$74.91	\$149.82
1	C947460-5GAL-M-1	Toulene solvent, 5 gallon container		\$236.93	\$236.93
1	P27S-7D5070-07	BF Goodrich FASTBoot, De-ice Boot, LH wing nacelle to tip		\$2,296.80	\$2,296.80
1	PEERCO321	Adhesive Remover		\$186.13	\$186.13

Item Summary	Labor: \$5,600.00	Parts: \$3,264.10	Shipping: \$0.00	Item Subtotal: \$8,864.10
--------------	-------------------	-------------------	------------------	---------------------------

Item: 76-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No**Discrepancy**

LH wing has fuel leaking from vent. (Troubleshoot)

Hours	Subtotal
3.00	\$420.00

Item Summary	Labor: \$420.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$420.00
--------------	-----------------	---------------	------------------	-------------------------

Item: 77-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No

Discrepancy				Hours	Subtotal
LH wing leading edge has corrosion under the paint along the length of the de-ice boot. Potential for corrosion to be under the boot too. Area needs to be striped, cleaned, and corrosion preventative applied before re-painting.				40.00	\$5,600.00
Item Summary	Labor: \$5,600.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$5,600.00

Item: 78-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No

Discrepancy				Hours	Subtotal
LH and RH fuel caps latches are very stiff and cap seals are dry rotting.				1.00	\$140.00
Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
2	MS29512-338	O-ring		\$1.07	\$2.14
Item Summary	Labor: \$140.00	Parts: \$2.14	Shipping: \$0.00	Item Subtotal:	\$142.14

Item: 79-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No

Discrepancy				Hours	Subtotal
LH wing gear door attachment rod ends and hardware are worn. As well as the piano hinge rod.				3.00	\$420.00
Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	5141145-1	Tube assembly, main gear door actuator		\$1,965.83	\$1,965.83
1	AN960PD416	Washer		\$20.15	\$20.15
1	MS20253-2-8.85	Pin hinge, gear door		\$57.09	\$57.09
Item Summary	Labor: \$420.00	Parts: \$2,043.07	Shipping: \$0.00	Item Subtotal:	\$2,463.07

Item: 80-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No

Discrepancy				Hours	Subtotal
Nose landing gear tire through bolt is corroded and required replacement.				0.50	\$70.00
Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	AN5-55	Bolt		\$17.84	\$17.84
1	MS17825-5	Nut		\$4.88	\$4.88
Item Summary	Labor: \$70.00	Parts: \$22.72	Shipping: \$0.00	Item Subtotal:	\$92.72

Item: 81-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No

Discrepancy				Hours	Subtotal
RH main landing gear actuator is leaking fluid around the extension rod.				10.00	\$1,400.00
Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	9910136-3	Actuator Assembly		\$15,950.00	\$15,950.00
Item Summary	Labor: \$1,400.00	Parts: \$15,950.00	Shipping: \$0.00	Item Subtotal:	\$17,350.00

Item: 82-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No

Discrepancy				Hours	Subtotal
Horizontal stabilizer, RH side, trailing edge has improperly repaired crack and dent/hangar rash. (Properly repair damage)				8.00	\$1,120.00
Item Summary	Labor: \$1,120.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$1,120.00

Item: 83-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No

Discrepancy				Hours	Subtotal
RH aileron bell crank pin and bearing are worn.				4.00	\$560.00
Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	5565384-3	Pin		\$992.14	\$992.14
1	AN4CH12A	Bolt		\$19.70	\$19.70

1	MS27645-5A	Bearing			\$89.69	\$89.69
Item Summary		Labor: \$560.00	Parts: \$1,101.53	Shipping: \$0.00	Item Subtotal:	\$1,661.53

Item: 84-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No**Discrepancy**

Horizontal stabilizer is full of bird nests and mold. Needs to be removed and the corrosion under it treated.

Hours	Subtotal
10.00	\$1,400.00

Item Summary		Labor: \$1,400.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$1,400.00
---------------------	--	--------------------------	----------------------	-------------------------	-----------------------	------------

Item: 85-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No**Discrepancy**

Rudder trim tab has excessive play. Hardware and rudder tab actuator require replacement.

Hours	Subtotal
6.00	\$840.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	5115275-12	Actuator assembly, rudder trim tab		\$1,728.56	\$1,728.56
1	CORE CHARGE	Returned unit P/N 5115275-12 is subject to up to \$5,000 core charge if it fails to meet the minimum core requirements.		\$0.00	\$0.00

Item Summary		Labor: \$840.00	Parts: \$1,728.56	Shipping: \$300.00	Item Subtotal:	\$2,868.56
---------------------	--	------------------------	--------------------------	---------------------------	-----------------------	------------

Item: 86-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No**Discrepancy**Horizontal stabilizer has corrosion under the paint on upper and lower skins near the base of the RH vertical stabilizer.
(Remove paint, clean and treat corrosion, and re-paint.)

Hours	Subtotal
6.00	\$840.00

Item Summary		Labor: \$840.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$840.00
---------------------	--	------------------------	----------------------	-------------------------	-----------------------	----------

Item: 87-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No**Discrepancy**

Main ship battery positive and negative wire passthrough grommets are torn and missing chunks.

Hours	Subtotal
1.00	\$140.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
2	NO48	Wire Grommet		\$139.61	\$279.22

Item Summary		Labor: \$140.00	Parts: \$279.22	Shipping: \$0.00	Item Subtotal:	\$419.22
---------------------	--	------------------------	------------------------	-------------------------	-----------------------	----------

Item: 88-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No**Discrepancy**

LH wing leading edge fuel tank sump is leaking at the inboard screw.

Hours	Subtotal
3.00	\$420.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
2	600-001-8	Seal		\$4.65	\$9.30

Item Summary		Labor: \$420.00	Parts: \$9.30	Shipping: \$0.00	Item Subtotal:	\$429.30
---------------------	--	------------------------	----------------------	-------------------------	-----------------------	----------

Item: 89-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No**Discrepancy**

LH wing root transponder antenna is deteriorated and antenna element is exposed.

Hours	Subtotal
1.00	\$140.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	CI-105-16	Antenna		\$258.15	\$258.15

Item Summary		Labor: \$140.00	Parts: \$258.15	Shipping: \$0.00	Item Subtotal:	\$398.15
---------------------	--	------------------------	------------------------	-------------------------	-----------------------	----------

Item: 90-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No

Discrepancy					Hours	Subtotal
Tail cone area has debris in it from birds and other animals.(Clean out)					2.00	\$280.00
Item Summary	Labor:	Parts:	Shipping:	Item Subtotal:	\$280.00	

Item: 91-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No

Discrepancy					Hours	Subtotal
AC system hydraulic fluid is low. (Service)					0.25	\$35.00
Qty	Part Number	Description	Serial Number	Unit Price	Subtotal	
1	09-27000-QT	Aeroshell 41 (MIL-PRF-5606) Fluid (Quart)		\$16.66	\$16.66	
Item Summary	Labor:	Parts:	Shipping:	Item Subtotal:	\$51.66	

Item: 92-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No

Discrepancy					Hours	Subtotal
RH wing has fuel leaking from vent. (Troubleshoot)					4.00	\$560.00
Item Summary	Labor:	Parts:	Shipping:	Item Subtotal:	\$560.00	

Item: 93-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No

Discrepancy					Hours	Subtotal
RH wing gear door attachment rod ends and hardware are worn. As well as the piano hinge rod too.					3.00	\$420.00
Qty	Part Number	Description	Serial Number	Unit Price	Subtotal	
1	5141145-1	Tube assembly, main gear door actuator		\$1,965.83	\$1,965.83	
1	AN960PD416	Washer		\$20.15	\$20.15	
1	MS20253-2-8.85	Pin hinge, gear door		\$57.09	\$57.09	
Item Summary	Labor:	Parts:	Shipping:	Item Subtotal:	\$2,463.07	

Item: 94-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No

Discrepancy					Hours	Subtotal
LH main landing gear disc is worn beyond limits.					2.00	\$280.00
Qty	Part Number	Description	Serial Number	Unit Price	Subtotal	
8	066-06600	Brake Lining		\$33.48	\$267.84	
1	164-20306	Brake Disc		\$673.65	\$673.65	
Item Summary	Labor:	Parts:	Shipping:	Item Subtotal:	\$1,221.49	

Item: 95-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No

Discrepancy					Hours	Subtotal
RH main landing gear disc is worn beyond limits.					2.00	\$280.00
Qty	Part Number	Description	Serial Number	Unit Price	Subtotal	
8	066-06600	Brake Lining		\$33.48	\$267.84	
1	164-20306	Brake Disc		\$673.65	\$673.65	
Item Summary	Labor:	Parts:	Shipping:	Item Subtotal:	\$1,221.49	

Item: 96-Airworthy AirframeAUTHORIZED ☐ Yes ☐ No

Discrepancy					Hours	Subtotal
RH wing fuel selector filter element is corroded and flaking.					1.00	\$140.00
Qty	Part Number	Description	Serial Number	Unit Price	Subtotal	
1	D9-47-1	Fuel Filter Element		\$798.23	\$798.23	

Item Summary	Labor: \$140.00	Parts: \$798.23	Shipping: \$0.00	Item Subtotal: \$938.23
---------------------	------------------------	------------------------	-------------------------	--------------------------------

Item: 97-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No
Discrepancy

Pilot seat forward seat rail retainers are bent/deformed.

Hours	Subtotal
0.25	\$35.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
2	5015073-3	BRACKET FWD LH		\$538.87	\$1,077.74
2	5015073-4	BRACKET FWD RH		\$408.96	\$817.92

Item Summary	Labor: \$35.00	Parts: \$1,895.66	Shipping: \$0.00	Item Subtotal: \$1,930.66
---------------------	-----------------------	--------------------------	-------------------------	----------------------------------

Item: 98-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No
Discrepancy

Verify operation of all instrument panel, switch panel, circuit breaker panel, and quadrant lights and that all posts are installed correctly.

Hours	Subtotal
1.50	\$210.00

Item Summary	Labor: \$210.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$210.00
---------------------	------------------------	----------------------	-------------------------	--------------------------------

Item: 99-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No
Discrepancy

LH master cylinder is showing signs of leakage from fittings.

Hours	Subtotal
4.00	\$560.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	PPBMC34	A-049-6 rebuild kit		\$35.57	\$35.57

Item Summary	Labor: \$560.00	Parts: \$35.57	Shipping: \$0.00	Item Subtotal: \$595.57
---------------------	------------------------	-----------------------	-------------------------	--------------------------------

Item: 100-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No
Discrepancy

Parking brake valve is leaking.

Hours	Subtotal
6.00	\$840.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	PPPBV20	He7002-3 Rebuild Kit		\$10.85	\$10.85

Item Summary	Labor: \$840.00	Parts: \$10.85	Shipping: \$0.00	Item Subtotal: \$850.85
---------------------	------------------------	-----------------------	-------------------------	--------------------------------

Item: 101-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No
Discrepancy

Coax cable is not secured and is chafing against the control cables.

Hours	Subtotal
N/C	\$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
---------------------	----------------------	----------------------	-------------------------	------------------------------

Item: 102-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No
Discrepancy

LH and RH lower fuselage skin, aft of wing spar, have panels cut through the pressure vessel and then secured with screws not sealed, no structural screws. These require rework and replacement with sealed fasteners.

Hours	Subtotal
6.00	\$840.00

Item Summary	Labor: \$840.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$840.00
---------------------	------------------------	----------------------	-------------------------	--------------------------------

Item: 103-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No
Discrepancy

Access panel below the speed brake power pack is not installed correctly. It requires sealed nut plates which are not installed.

Hours	Subtotal
6.00	\$840.00

Item Summary	Labor: \$840.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$840.00
---------------------	------------------------	----------------------	-------------------------	--------------------------------

Item: 104-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No
Discrepancy

Crossover duct in the fuselage flooring is corroding panels and ribs.

Hours	Subtotal
4.00	\$560.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	5117257-5	Heater duct		\$637.58	\$637.58

Item Summary	Labor: \$560.00	Parts: \$637.58	Shipping: \$0.00	Item Subtotal: \$1,197.58
---------------------	------------------------	------------------------	-------------------------	----------------------------------

Item: 105-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No
Discrepancy

RH rudder cable, aft cabin pulley brackets are bent.

Hours	Subtotal
1.00	\$140.00

Item Summary	Labor: \$140.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$140.00
---------------------	------------------------	----------------------	-------------------------	--------------------------------

Item: 106-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No
Discrepancy

Cap stuck between ducting and stringer forward of the co-pilot rudder pedals. (Remove debris)

Hours	Subtotal
0.50	\$70.00

Item Summary	Labor: \$70.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$70.00
---------------------	-----------------------	----------------------	-------------------------	-------------------------------

Item: 107-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No
Discrepancy

Ducting under the co-pilot's floorboards chaffing into the fuselage belly skins and causing corrosion. (Reposition ducting and secure)

Hours	Subtotal
3.00	\$420.00

Item Summary	Labor: \$420.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$420.00
---------------------	------------------------	----------------------	-------------------------	--------------------------------

Item: 108-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No
Discrepancy

Under cabin floorboards has lots of debris under it. (Clean debris)

Hours	Subtotal
1.00	\$140.00

Item Summary	Labor: \$140.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$140.00
---------------------	------------------------	----------------------	-------------------------	--------------------------------

Item: 109-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No
Discrepancy

RH evaporator drain not seated/sealed properly.

Hours	Subtotal
0.50	\$70.00

Item Summary	Labor: \$70.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$70.00
---------------------	-----------------------	----------------------	-------------------------	-------------------------------

Item: 110-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No
Discrepancy

Debris under the circuit breaker panels. (Clean debris)

Hours	Subtotal
0.50	\$70.00

Item Summary	Labor: \$70.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$70.00
---------------------	-----------------------	----------------------	-------------------------	-------------------------------

Item: 111-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No
Discrepancy

Flap motor is safety wired with the incorrect size safety wire.

Hours	Subtotal
N/C	\$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
---------------------	----------------------	----------------------	-------------------------	------------------------------

Item: 112-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No
Discrepancy

Parking brake placard is not secured.

Hours	Subtotal
N/C	\$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
---------------------	----------------------	----------------------	-------------------------	------------------------------

Item: 113-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No
Discrepancy

Emergency exit door placard is missing.

Hours	Subtotal
0.25	\$35.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	5119564-6	Placard, emergency exit with aft facing seat		\$152.13	\$152.13

Item Summary	Labor: \$35.00	Parts: \$152.13	Shipping: \$0.00	Item Subtotal: \$187.13
---------------------	-----------------------	------------------------	-------------------------	--------------------------------

Item: 114-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No
Discrepancy

RH and LH brakes have corrosion on various parts that require replacement.

Hours	Subtotal
4.00	\$560.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
2	063-02600	Pressure plate		\$674.41	\$1,348.82
8	064-02700	Back plate		\$358.92	\$2,871.36
2	068-03100	Brake Shim, Rapco		\$277.31	\$554.62
32	177-01600	Pin		\$41.87	\$1,339.84

Item Summary	Labor: \$560.00	Parts: \$6,114.64	Shipping: \$0.00	Item Subtotal: \$6,674.64
---------------------	------------------------	--------------------------	-------------------------	----------------------------------

Item: 115-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No
Discrepancy

Pilot's RH static source drain placard is missing.

Hours	Subtotal
1.00	\$140.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	5300181-22	Placard		\$119.30	\$119.30

Item Summary	Labor: \$140.00	Parts: \$119.30	Shipping: \$0.00	Item Subtotal: \$259.30
---------------------	------------------------	------------------------	-------------------------	--------------------------------

Item: 116-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No
Discrepancy

Check door lock indicator placard is missing.

Hours	Subtotal
0.25	\$35.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	5200181-20	Placard		\$58.28	\$58.28

Item Summary	Labor: \$35.00	Parts: \$58.28	Shipping: \$0.00	Item Subtotal: \$93.28
---------------------	-----------------------	-----------------------	-------------------------	-------------------------------

Item: 117-Airworthy Airframe
 AUTHORIZED ☐ Yes ☐ No
Discrepancy

Max baggage weight at station 276 placard is missing.

Hours	Subtotal
0.25	\$35.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	5100181-11	Placard		\$106.41	\$106.41

Item Summary	Labor: \$35.00	Parts: \$106.41	Shipping: \$0.00	Item Subtotal: \$141.41
---------------------	-----------------------	------------------------	-------------------------	--------------------------------

Item: 118-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

LH engine outboard cowling chaffed through on trailing edge. (Repair hole) Hours 8.00 Subtotal \$1,120.00

Item Summary Labor: \$1,120.00 Parts: \$0.00 Shipping: \$0.00 Item Subtotal: \$1,120.00

Item: 119-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

LH engine cowling has three oversized cam-loc holes. Hours 0.50 Subtotal \$70.00

Item Summary Labor: \$70.00 Parts: \$0.00 Shipping: \$0.00 Item Subtotal: \$70.00

Item: 120-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

Lower cabin door latch detent spring is broken Hours 1.50 Subtotal \$210.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	5111527-2	Spring		\$109.77	\$109.77

Item Summary Labor: \$210.00 Parts: \$109.77 Shipping: \$0.00 Item Subtotal: \$319.77

Item: 121-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

RH engine outboard cowling has a doubler that is chafed through. (Repair) Hours 6.00 Subtotal \$840.00

Item Summary Labor: \$840.00 Parts: \$0.00 Shipping: \$0.00 Item Subtotal: \$840.00

Item: 122-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

RH engine cowl flap attachment hardware are worn and the spring is not attached. Hours 1.00 Subtotal \$140.00

Item Summary Labor: \$140.00 Parts: \$0.00 Shipping: \$0.00 Item Subtotal: \$140.00

Item: 123-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

LH engine cowl flap attachment hardware are worn and the spring is not attached. Hours 1.00 Subtotal \$140.00

Item Summary Labor: \$140.00 Parts: \$0.00 Shipping: \$0.00 Item Subtotal: \$140.00

Item: 124-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

LH cockpit cowl flap control is loose in the pedestal. Hours 0.15 Subtotal \$21.00

Item Summary Labor: \$21.00 Parts: \$0.00 Shipping: \$0.00 Item Subtotal: \$21.00

Item: 125-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

Service all landing gear struts to proper pressures. Hours 3.00 Subtotal \$420.00

Item Summary Labor: \$420.00 Parts: \$0.00 Shipping: \$0.00 Item Subtotal: \$420.00

Item: 126-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

Elevator cable tensions are low.

Hours **Subtotal**
2.00 \$280.00

Item Summary **Labor:** \$280.00 **Parts:** \$0.00 **Shipping:** \$0.00 **Item Subtotal:** \$280.00

Item: 127-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

Rudder trim cable tensions are low.

Hours **Subtotal**
2.00 \$280.00

Item Summary **Labor:** \$280.00 **Parts:** \$0.00 **Shipping:** \$0.00 **Item Subtotal:** \$280.00

Item: 128-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

Nose steering cable tensions and rigging check required.

Hours **Subtotal**
4.00 \$560.00

Item Summary **Labor:** \$560.00 **Parts:** \$0.00 **Shipping:** \$0.00 **Item Subtotal:** \$560.00

Item: 129-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

Rudder autopilot servo cables tension are low.

Hours **Subtotal**
2.00 \$280.00

Item Summary **Labor:** \$280.00 **Parts:** \$0.00 **Shipping:** \$0.00 **Item Subtotal:** \$280.00

Item: 130-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

LH wing fuel selector valve is leaking fuel from valve body.

Hours **Subtotal**
10.00 \$1,400.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	9910201-1	Fuel valve		\$1,054.00	\$1,054.00
1	CORE CHARGE	Returned unit P/N 9910201-1 is subject to up to \$500 core charge if it fails to meet the minimum core requirements.		\$0.00	\$0.00
Item Summary				Labor: \$1,400.00	Item Subtotal: \$2,454.00

Item: 131-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

RH wing fuel selector valve is leaking fuel from valve body.

Hours **Subtotal**
10.00 \$1,400.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	9910201-1	Fuel valve		\$1,054.00	\$1,054.00
1	CORE CHARGE	Returned unit P/N 9910201-1 is subject to up to \$500 core charge if it fails to meet the minimum core requirements.		\$0.00	\$0.00
Item Summary				Labor: \$1,400.00	Item Subtotal: \$2,454.00

Item: 132-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

Pilot seat base floor light is missing.

Hours **Subtotal**
1.00 \$140.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	C622005-0101	Light assembly		\$204.00	\$204.00
Item Summary				Labor: \$140.00	Item Subtotal: \$344.00

Item: 133-Airworthy Airframe

AUTHORIZED ☐ Yes ☐ No

Discrepancy

LH alternate air knob is broken.

Hours	Subtotal
3.00	\$420.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	9910271-11	CONTROL ALTERNATE AIR LH		\$674.56	\$674.56

Item Summary	Labor: \$420.00	Parts: \$674.56	Shipping: \$0.00	Item Subtotal:	\$1,094.56
--------------	-----------------	-----------------	------------------	----------------	------------

Item: 134-Airworthy Engine

AUTHORIZED ☐ Yes ☐ No

Discrepancy

LH and RH engine rigging an adjustments required. (Comply with fuel set up SB)

Hours	Subtotal
12.00	\$1,680.00

Item Summary	Labor: \$1,680.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$1,680.00
--------------	-------------------	---------------	------------------	----------------	------------

Item: 135-Airworthy Engine

AUTHORIZED ☐ Yes ☐ No

Discrepancy

Remove and replace RH engine cylinder #1 and cylinder #5 due to low compression.

Hours	Subtotal
16.00	\$2,240.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
4	649959	Gasket		\$1.36	\$5.44
4	652458	Gasket		\$44.33	\$177.32
4	655528	Rocker Cover Gasket		\$15.87	\$63.48
6	658077	Exhaust Lifter		\$252.82	\$1,516.92
6	658088	Intake Lifter		\$260.70	\$1,564.20
4	658088	Intake Lifter		\$260.70	\$1,042.80
2	CL71.4-221-OH	Overhauled Nickel Cylinder for Continental GTSIO and TSIO-520 and IO-520/550 Engines		\$2,736.00	\$5,472.00

Item Summary	Labor: \$2,240.00	Parts: \$9,842.16	Shipping: \$120.00	Item Subtotal:	\$12,202.16
--------------	-------------------	-------------------	--------------------	----------------	-------------

Item: 136-Airworthy Engine

AUTHORIZED ☐ Yes ☐ No

Discrepancy

RH engine vacuum pump is INOP. Requires blowing out vacuum lines.

Hours	Subtotal
3.50	\$490.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	653487	Gasket		\$3.35	\$3.35
1	AA442CW	Vacuum Pump		\$1,516.16	\$1,516.16

Item Summary	Labor: \$490.00	Parts: \$1,519.51	Shipping: \$0.00	Item Subtotal:	\$2,009.51
--------------	-----------------	-------------------	------------------	----------------	------------

Item: 137-Airworthy Engine

AUTHORIZED ☐ Yes ☐ No

Discrepancy

RH engine oil pressure drops to near zero after oil gets hot and the engine is brought to idle.

Hours	Subtotal
4.00	\$560.00

Item Summary	Labor: \$560.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$560.00
--------------	-----------------	---------------	------------------	----------------	----------

Item: 138-Airworthy Engine

AUTHORIZED ☐ Yes ☐ No

Discrepancy

LH engine oil pressure stay above green arc even when engine is warmed up.

Hours	Subtotal
4.00	\$560.00

Item Summary	Labor: \$560.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal:	\$560.00
--------------	-----------------	---------------	------------------	----------------	----------

Item: 139-Airworthy Engine

AUTHORIZED ☐ Yes ☐ No

Discrepancy

LH engine turbo is seized. Recommend overhauling the turbo, wastegaste, and wastegate controller at this time.

Hours	Subtotal
20.00	\$2,800.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	1418-1	RAM Series VII Turbocharger oil outlet gasket		\$9.30	\$9.30
2	2570-1	Gasket, wastegate mounting		\$35.65	\$71.30
1	466412-0005	Turbocharger, RAM Series VII		\$6,128.40	\$6,128.40
1	470908-9012	Wastegate, RAM series VII		\$3,940.80	\$3,940.80
1	653006	Gasket		\$6.68	\$6.68
1	CORE CHARGE	Returned unit P/N 470908-9012 is subject to up to \$800 core charge if it fails to meet the minimum core requirements.		\$0.00	\$0.00
1	CORE CHARGE	Returned unit P/N 466412-0005 is subject to up to \$2,000 core charge if it fails to meet the minimum core requirements.		\$0.00	\$0.00

Item Summary	Labor: \$2,800.00	Parts: \$10,156.48	Shipping: \$240.00	Item Subtotal: \$13,196.48
--------------	-------------------	--------------------	--------------------	----------------------------

Item: 140-Airworthy Engine

AUTHORIZED	<input type="checkbox"/> Yes	<input type="checkbox"/> No
------------	------------------------------	-----------------------------

Discrepancy

RH engine, RH magneto needs to be removed and internally timed. Impulse coupling is corroded and requires replacement too.

Hours	Subtotal
3.50	\$490.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	649954	Gasket: Magneto, Rubber		\$1.86	\$1.86
1	M3050	Impulse coupling, SLICK		\$989.52	\$989.52

Item Summary	Labor: \$490.00	Parts: \$991.38	Shipping: \$0.00	Item Subtotal: \$1,481.38
--------------	-----------------	-----------------	------------------	---------------------------

Item: 141-Airworthy Engine

AUTHORIZED	<input type="checkbox"/> Yes	<input type="checkbox"/> No
------------	------------------------------	-----------------------------

Discrepancy

LH engine tailpipe support clamp is loose.

Hours	Subtotal
N/C	\$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
--------------	---------------	---------------	------------------	-----------------------

Item: 142-Airworthy Engine

AUTHORIZED	<input type="checkbox"/> Yes	<input type="checkbox"/> No
------------	------------------------------	-----------------------------

Discrepancy

LH and RH engines have several broken or stripped aluminum baffling screws.

Hours	Subtotal
1.00	\$140.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	41402-16	Fasteners		\$1.55	\$1.55

Item Summary	Labor: \$140.00	Parts: \$1.55	Shipping: \$0.00	Item Subtotal: \$141.55
--------------	-----------------	---------------	------------------	-------------------------

Item: 143-Airworthy Engine

AUTHORIZED	<input type="checkbox"/> Yes	<input type="checkbox"/> No
------------	------------------------------	-----------------------------

Discrepancy

RH engine #2 cylinder inner cylinder baffling spring is pulled through the baffling where it attaches.

Hours	Subtotal
1.00	\$140.00

Item Summary	Labor: \$140.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$140.00
--------------	-----------------	---------------	------------------	-------------------------

Item: 144-Airworthy Engine

AUTHORIZED	<input type="checkbox"/> Yes	<input type="checkbox"/> No
------------	------------------------------	-----------------------------

Discrepancy

RH engine has bird nests in oil cooler and baffling. (Clean and treat)

Hours	Subtotal
0.25	\$35.00

Item Summary	Labor: \$35.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$35.00
--------------	----------------	---------------	------------------	------------------------

Item: 145-Airworthy Engine

AUTHORIZED	<input type="checkbox"/> Yes	<input type="checkbox"/> No
------------	------------------------------	-----------------------------

Discrepancy

RH engine has oil leak coming from RH magneto base seal.

Hours

N/C

Subtotal

\$0.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	649954	Gasket: Magneto, Rubber		\$1.86	\$1.86
Item Summary		Labor: \$0.00	Parts: \$1.86	Shipping: \$0.00	Item Subtotal: \$1.86

Item: 146-Airworthy EngineAUTHORIZED ☐ Yes ☐ No**Discrepancy**

RH engine has three worn lower spark plugs for cylinders 1, 2, and 3.

Hours

0.25

Subtotal

\$35.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
3	URHB32E	Spark Plug		\$55.57	\$166.71
Item Summary		Labor: \$35.00	Parts: \$166.71	Shipping: \$0.00	Item Subtotal: \$201.71

Item: 147-Airworthy EngineAUTHORIZED ☐ Yes ☐ No**Discrepancy**

LH engine spark plugs are all worn and require replacement.

Hours

0.50

Subtotal

\$70.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
12	URHB32E	Spark Plug		\$55.57	\$666.84
Item Summary		Labor: \$70.00	Parts: \$666.84	Shipping: \$0.00	Item Subtotal: \$736.84

Item: 148-Airworthy EngineAUTHORIZED ☐ Yes ☐ No**Discrepancy**

LH engine has bird nests in the baffling and oil cooler area. (Clean and treat)

Hours

0.50

Subtotal

\$70.00

Item Summary		Labor: \$70.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$70.00
---------------------	--	-----------------------	----------------------	-------------------------	-------------------------------

Item: 149-Airworthy EngineAUTHORIZED ☐ Yes ☐ No**Discrepancy**

LH engine fire bottle is due for hydrostatic inspection.

Hours

0.75

Subtotal

\$994.20

Outside Repair

Labor: \$889.20, Parts: \$0.00, Part No: 30111102 Fire Bottle

Item Summary		Labor: \$994.20	Parts: \$0.00	Shipping: \$360.00	Item Subtotal: \$1,354.20
---------------------	--	------------------------	----------------------	---------------------------	----------------------------------

Item: 150-Airworthy EngineAUTHORIZED ☐ Yes ☐ No**Discrepancy**

RH engine fire bottle is due for hydrostatic inspection.

Hours

0.75

Subtotal

\$994.20

Outside Repair

Labor: \$889.20, Parts: \$0.00, Part No: 30111102 Fire Bottle

Item Summary		Labor: \$994.20	Parts: \$0.00	Shipping: \$360.00	Item Subtotal: \$1,354.20
---------------------	--	------------------------	----------------------	---------------------------	----------------------------------

Item: 151-Airworthy EngineAUTHORIZED ☐ Yes ☐ No**Discrepancy**

LH engine fire bottle squib is due for replacement.

Hours

0.75

Subtotal

\$105.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	AE13083-5	Cartridge		\$747.48	\$747.48
Item Summary		Labor: \$105.00	Parts: \$747.48	Shipping: \$0.00	Item Subtotal: \$852.48

Item: 152-Airworthy Engine

AUTHORIZED ☐ Yes ☐ No

Discrepancy

RH engine fire bottle squib is due for replacement.

Hours **Subtotal**
0.75 \$105.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	AE13083-5	Cartridge		\$747.48	\$747.48

Item Summary **Labor:** \$105.00 **Parts:** \$747.48 **Shipping:** \$0.00 **Item Subtotal:** \$852.48

Item: 153-Airworthy Engine

AUTHORIZED ☐ Yes ☐ No

Discrepancy

LH engine turbo baffling shroud is installed incorrectly.

Hours **Subtotal**
2.00 \$280.00

Item Summary **Labor:** \$280.00 **Parts:** \$0.00 **Shipping:** \$0.00 **Item Subtotal:** \$280.00

Item: 154-Airworthy Engine

AUTHORIZED ☐ Yes ☐ No

Discrepancy

RH engine turbo baffling shroud is installed incorrectly.

Hours **Subtotal**
2.00 \$280.00

Item Summary **Labor:** \$280.00 **Parts:** \$0.00 **Shipping:** \$0.00 **Item Subtotal:** \$280.00

Item: 155-Airworthy Engine

AUTHORIZED ☐ Yes ☐ No

Discrepancy

RH engine fuel line from fuel controller to fuel flow unit is chafing on the intake box.

Hours **Subtotal**
N/C \$0.00

Item Summary **Labor:** \$0.00 **Parts:** \$0.00 **Shipping:** \$0.00 **Item Subtotal:** \$0.00

Item: 156-Airworthy Engine

AUTHORIZED ☐ Yes ☐ No

Discrepancy

LH engine magneto pressurization filter replacement is due.

Hours **Subtotal**
0.10 \$14.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	653386	Filter		\$609.52	\$609.52

Item Summary **Labor:** \$14.00 **Parts:** \$609.52 **Shipping:** \$0.00 **Item Subtotal:** \$623.52

Item: 157-Airworthy Engine

AUTHORIZED ☐ Yes ☐ No

Discrepancy

RH engine magneto pressurization filter replacement is due.

Hours **Subtotal**
0.10 \$14.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	653386	Filter		\$609.52	\$609.52

Item Summary **Labor:** \$14.00 **Parts:** \$609.52 **Shipping:** \$0.00 **Item Subtotal:** \$623.52

Item: 158-Airworthy Engine

AUTHORIZED ☐ Yes ☐ No

Discrepancy

LH engine fire tube is chafing on the inboard upper deck line.

Hours **Subtotal**
N/C \$0.00

Item Summary **Labor:** \$0.00 **Parts:** \$0.00 **Shipping:** \$0.00 **Item Subtotal:** \$0.00

Item: 159-Airworthy Engine

AUTHORIZED ☐ Yes ☐ No

Discrepancy

LH alternator leaking around the base gasket.

Hours **Subtotal**
1.00 \$140.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	653981	Gasket		\$11.02	\$11.02

Item Summary **Labor:** \$140.00 **Parts:** \$11.02 **Shipping:** \$0.00 **Item Subtotal:** \$151.02

Item: 160-Airworthy Engine

AUTHORIZED ☐ Yes ☐ No

Discrepancy

LH engine has old fuel staining around the injector port mounts. (clean residue)

Hours **Subtotal**
N/C \$0.00

Item Summary **Labor:** \$0.00 **Parts:** \$0.00 **Shipping:** \$0.00 **Item Subtotal:** \$0.00

Item: 161-Airworthy Engine

AUTHORIZED ☐ Yes ☐ No

Discrepancy

LH engine cylinders #1, 3, and 5 pushrod base tubes are leaking oil.

Hours **Subtotal**
8.00 \$1,120.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
12	534610	TCM Pushrod Tube Packing		\$2.31	\$27.72

Item Summary **Labor:** \$1,120.00 **Parts:** \$27.72 **Shipping:** \$0.00 **Item Subtotal:** \$1,147.72

Item: 162-Airworthy Engine

AUTHORIZED ☐ Yes ☐ No

Discrepancy

Replace both engine air filters.

Hours **Subtotal**
N/C \$0.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
2	P12-8156	Engine air filter		\$158.88	\$317.76

Item Summary **Labor:** \$0.00 **Parts:** \$317.76 **Shipping:** \$0.00 **Item Subtotal:** \$317.76

Item: 163-Airworthy Engine

AUTHORIZED ☐ Yes ☐ No

Discrepancy

RH engine rigid line from wastegate actuator to controller is chaffed.

Hours **Subtotal**
0.50 \$70.00

Qty	Part Number	Description	Serial Number	Unit Price	Subtotal
1	5600109-6	Line, wastegate actuator to controller		\$476.40	\$476.40

Item Summary **Labor:** \$70.00 **Parts:** \$476.40 **Shipping:** \$0.00 **Item Subtotal:** \$546.40

Item: 164-Airworthy Propeller

AUTHORIZED ☐ Yes ☐ No

Discrepancy

LH propeller dome pressure is low.

Hours **Subtotal**
N/C \$0.00

Item Summary **Labor:** \$0.00 **Parts:** \$0.00 **Shipping:** \$0.00 **Item Subtotal:** \$0.00

Item: 165-Airworthy Propeller

AUTHORIZED ☐ Yes ☐ No

Discrepancy

LH prop does not change pitch when moving the prop lever until the lever goes into the feather detent.

Hours **Subtotal**
3.00 \$1,320.00

Outside Repair

Labor: \$900.00, Parts: \$0.00, Part No: DCF5290D9/T3 Prop Governor

Item Summary **Labor:** \$1,320.00 **Parts:** \$0.00 **Shipping:** \$240.00 **Item Subtotal:** \$1,560.00

Item: 166-Airworthy Propeller

AUTHORIZED ☐ Yes ☐ No

Discrepancy

LH prop de-ice boot wires have broken zip-ties.

Hours **Subtotal**
N/C \$0.00

Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
Item: 167-Airworthy Propeller				
AUTHORIZED <input type="checkbox"/> Yes <input type="checkbox"/> No				
Discrepancy				Hours Subtotal
RH propeller dome pressure is low. (Service)			N/C	\$0.00
Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
Item: 168-Airworthy Propeller				
AUTHORIZED <input type="checkbox"/> Yes <input type="checkbox"/> No				
Discrepancy				Hours Subtotal
RH prop de-ice boot wires have broken zip-ties.			N/C	\$0.00
Item Summary	Labor: \$0.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$0.00
Item: 169-Airworthy Propeller				
AUTHORIZED <input type="checkbox"/> Yes <input type="checkbox"/> No				
Discrepancy				Hours Subtotal
RH propeller de-ice brush block mount is corroded.			0.75	\$105.00
Item Summary	Labor: \$105.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$105.00
Item: 170-Airworthy Propeller				
AUTHORIZED <input type="checkbox"/> Yes <input type="checkbox"/> No				
Discrepancy				Hours Subtotal
LH propeller is leaking oil at the mounting flange.			3.00	\$420.00
Qty	Part Number	Description	Serial Number	Unit Price Subtotal
1	C-3317-228	O-Ring		\$9.30 \$9.30
Item Summary	Labor: \$420.00	Parts: \$9.30	Shipping: \$0.00	Item Subtotal: \$429.30
Item: 171-Airworthy Propeller				
AUTHORIZED <input type="checkbox"/> Yes <input type="checkbox"/> No				
Discrepancy				Hours Subtotal
LH propeller blades need to be dressed.			0.75	\$105.00
Item Summary	Labor: \$105.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$105.00
Item: 172-Airworthy Propeller				
AUTHORIZED <input type="checkbox"/> Yes <input type="checkbox"/> No				
Discrepancy				Hours Subtotal
RH propeller blades need to be dressed.			0.75	\$105.00
Item Summary	Labor: \$105.00	Parts: \$0.00	Shipping: \$0.00	Item Subtotal: \$105.00

Misc Charges Total: \$1,200.00

- Estimated Shipping - Estimated Cost of total shipping: \$1,200.00

Total Shop Labor: \$69,534.00
Total Shop Parts: \$88,139.91
Total Shipping: \$2,280.00
Total Outside Repair: \$5,348.40
Additional Charges: \$1,200.00
Tax: \$7,558.64
Total Estimate: \$174,060.95

Important Information

This estimate for parts and labor is valid for 30 days from date of estimate.

Shipping charges are estimated and are subject to change.

A payment in full for parts ordered may be required prior to aircraft arrival. This will stand as a place holder to our shop schedule.

If work to be performed falls outside of normal business hours an AOG fee of \$250 may be assessed.

An updated estimate will be sent for your approval if the total cost of the work order previously approved increases by 10% or more. If you would like to be notified more frequently, then please reach out to the maintenance office and let us know.

Your aircraft and log entires will be released upon final payment. Once we have received payment your aircraft will need to be pick up within 48 hours. If unable to do so we will find hangar space to store your aircraft, you will be charged an additional fee for hangar space.

Signature & Date