



WORLDWIDE AVIATION • EST. 1967

N4AF

1968 CESSNA 421

RECORDS VOLUME

RIGHT PROPELLER LOGBOOKS

YEAR
1968

REGISTRATION
N4AF

SERIAL NO.
421-0142

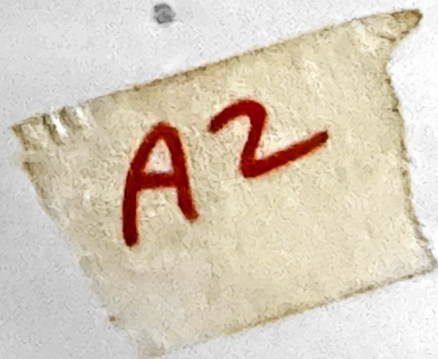
Prepared by the worldwide aviation specialists at RidgeAir, Inc.

RUSK, TX • HOUSTON, TX • TYLER, TX • (903) 586-1521 • RIDGEAIRE.COM

PROP WORKS, INC.

Propeller Log Book

N4AF
Right



FAA Repair Station T4ZR741Y

407-933-5551 Office
407-933-8643 Fax
sales@propworksinc.com

116 Hand Street
Kissimmee, FL 34741
www.propworksinc.com

Owner Name Thomas Handzlik

Address 2931 Falcon Way
Midlothian, Texas 76065

Propeller Make McCaulley

Propeller Model 3AF34C92-PR/590LF-2

Hub Serial No. ~~737248~~ 737248

Blade Model 590LF-2

Blade Serial No. 1 B38436Y5

2 B37426Y5

3 B38437Y5

4 _____

5 _____


PITCH RANGE

Low _____ High/Feather _____

Start Lock _____ Reverse _____

Time Between Overhaul Required By Manufacturer: _____ Hours or _____ Calendar Months

MAINTENANCE & SERVICE HISTORY

Date	Total Propeller Time	Time Since Overhaul	Description Of Work	Authorized Signatures Repairman and Station Certificate Numbers
Prop Works, Inc. Aircraft Propeller Specialists				
			Date: 5-12-09 Model No: 3AF34C92-PR/S90LF-2 Serial No: 737248 PW#: PW2156 This McCauley propeller overhauled in reference to McCauley Manuals 710930, SPM100-04 and BOM 100-04. Propeller approved for return to service. TTSN: Unknown TTSO: 0:00  Leonard Ciskowski Authorized Signature	
			FAA Repair Station # T4ZR741Y	

MAINTENANCE & SERVICE HISTORY

Date	Total Propeller Time	Time Since Overhaul	Description Of Work	Authorized Signatures Repairman and Station Certificate Numbers
8/10/2009	N4AF S/N 0142 Prop TTSO 0.00	ACTT 2529.8 Prop TTSN Unknown	Hobbs 129.8 RH ENG TTSO 729.8	
Installed propeller p/n 3AF34C92-PR/S90LF-2 s/n 737248 on the RH engine this aircraft after overhaul by Prop Works, Inc. w.o. PW2156. no leaks noted, operational checks good THIS AIRCRAFT HAS BEEN INSPECTED AND MAINTAINED IN ACCORDANCE WITH THE MANUFACTURES MAINTENANCE PROGRAM. THIS AIRCRAFT IS APPROVED FOR RETURN TO SERVICE PERTAINING TO THE WORK PERFORMED ON THIS DATE. ERIC KELLER A&P 3428700 <i>Eric Keller</i>				

MAINTENANCE & SERVICE HISTORY

[illegible]

N4AF (Right Prop logs)
McCauley 3AF34C92-PR S/N 737348

Inspected prop per 100 hr. checklist meeting requirements of FAR 43 App. D. in conjunction with Annual Inspection on Cessna 421, s/n 421-0142 this date. Performed post inspection operational checks per FAR43.15 (c)
Installed used serviceable right side prop spinner. Repaired prop deice boot connection eyelet.
Light filed and painted

DATE 2/1/2016 HOBBS 119.0 ACFT TT 2724.0 Prop TSMOVH 194.2
"I CERTIFY THAT THIS PROP HAS BEEN INSPECTED IN ACCORDANCE WITH AN 100 HR. AND
WAS DETERMINED TO BE IN AIRWORTHY CONDITION."

Anthony R. Saxton AP32537461A

Aircraft Accessories of Oklahoma
2740 North Sheridan Road
Tulsa, OK 74115
800-255-9924
Repair Station # RV3R829L

30-Jun-2017
wo 17-22932

Prop Serial 737248
Prop Model 3AF34C92-PR

Reseal Hub Only. Pressure Test OK. Hub Serviced with Oil.

This propeller is approved for return to service on this day.

Py M Tam

Philip M. Trout
Inspector # 2413577


MAINTENANCE & SERVICE HISTORY

Date	Total Propeller Time	Time Since Overhaul	Description Of Work	Authorized Signatures Repairman and Station Certificate Numbers
 16111 Addison Road, Suite 100, Addison, TX 75001 972-866-8814 Right Propeller Logbook Entry N4AF				
	Cessna 421 S/N 421-0124	Hobbs: 205.0	AFTT: 2810.0	09/01/2017
	Propeller 3AF34C92PR S/N22932	TSOH: 280.2	OVH 4/2009	TSN: UNK
Annual inspection performed, Dress minor nicks from blades, Removed and sent to CRS# RV3R829L for reseat of hub under WO# 22931, Install new P/N SMR1188-3 boots on all blades, I certify this propeller has been inspected and/or repaired in accordance with current Federal Aviation Regulations found to be in airworthy condition and is hereby returned to service with respect to work performed.				
Joseph V Brown A&P2268121A				

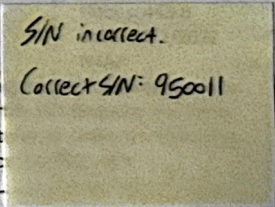
MAINTENANCE & SERVICE HISTORY

Date	Total Propeller Time	Time Since Overhaul	Description Of Work	Authorized Signatures Repairman and Station Certificate Numbers
REG NO <u>N4AF</u> MODEL <u>C421</u> S/N <u>41-0142</u> PROP MOD <u>XXXX</u> PROP S/N <u>XXX</u> CHANDLER AVIATION INC CHANDLER MUNICIPAL CHANDLER, AZ (480) 732-9118 DATE <u>08/06/18</u> WO# <u>55285</u> TACH <u>XXX</u> HOBBS <u>254.6</u> TOTAL <u>XXX</u> THE AIRCRAFT AND/OR COMPONENT IDENTIFIED ABOVE WAS REPAIRED AND INSPECTED IN ACCORDANCE WITH CURRENT FEDERAL AIR REGULATIONS AND WAS FOUND AIRWORTHY FOR RETURN TO SERVICE ON THE DATE STATED ABOVE. PERTINENT DETAILS OF THE REPAIR ARE ON FILE AT THIS FACILITY. SIGNATURE <u>[Signature]</u> AUTH. NO. <u>206463594 A&P</u> Remove and replace RT engine prop o-ring. END				

MAINTENANCE & SERVICE HISTORY

Date	Total Propeller Time	Time Since Overhaul	Description Of Work	Authorized Signatures Repairman and Station Certificate Numbers
 16111 Addison Road, Suite 100, Addison, TX 75001 972-866-8814 Right Propeller Logbook Entry N4AF				
	Cessna 421 S/N 421-0124	Hobbs: 262.8	AFTT: 2867.8	04/01/2019
	Propeller 3AF34C92PR S/N950011	TSOH: 338.0	OVH 4/2009	TSN: UNK
Annual inspection performed, Dress minor nicks from blades, Removed and sent to CRS# WN1R590K for repair under WO#40039 hub S/N 737248 was replaced with S/N 950011 due to stud pulling out, I certify this propeller has been inspected and/or repaired in accordance with current Federal Aviation Regulations found to be in airworthy condition and is hereby returned to service with respect to work performed.				
 Joseph L. Brown A&P 2268121A				

MAINTENANCE & SERVICE HISTORY

Date	Total Propeller Time	Time Since Overhaul	Description Of Work	Authorized Signatures Repairman and Station Certificate Numbers
Augustus Aviation Service		L/H propeller	TSOH: 525 S/N: 920327	
9000 N. Navarro Rd. Corsicana Tx, 75109 (469)235-4674				
Completed a 100hr inspection to propeller in accordance with FAR43 a				
Cessna 421 inspection guide. Dressed propeller blades as needed. I cer			Correct S/N: 950011	
inspected in accordance with a 100hr inspection and was determined t			William Koonc	
				

Propeller Model: McCauley 3AF34C92- PR/S90LF-2	Propeller S/N: 950011	Reg No: N4AF	AC Tach: 490.3	AC Hobbs: 485.1	Prop TT: UKN AFTT: 3090.1	Prop TSOH: 222.8	Date: 05/22/2024
Performed 100hr inspection in reference to Cessna Maintenance Manual P/N D817-15-13 and IAW 14 CFR 43 Appendix D.							

PK/S90LF-2	Performed 100hr inspection in reference to Cessna Maintenance Manual P/N D817-15-13 and IAW 14 CFR 43 Appendix D.
------------	---

I certify that this propeller has been inspected IAW annual/100hr inspection and was determined to be in airworthy condition.

Greg Dukes AP3507138IA

[illegible][illegible]