

RIDGEAIRE

AIRCRAFT SALES · ACQUISITIONS · APPRAISALS

AIRFRAME LOGBOOK



1961 Beechcraft 95-55 Baron

N1268Z

SERIAL NUMBER TC-84

AIRFRAME LOGBOOK

N 1268Z

Log book 3

AIRCRAFT LOG
AL-12P

AIRCRAFT DESCRIPTION

Book 3

MANUFACTURER Beech MODEL 95-55 DATE OF MFG. _____

SERIAL NUMBER TC-84 REGISTRATION NUMBER N 1268Z

REGISTERED OWNER _____

STREET ADDRESS _____

CITY, STATE, ZIP _____

OPERATOR _____

STREET ADDRESS _____

CITY, STATE, ZIP _____

REGISTERED OWNER _____

STREET ADDRESS _____

CITY, STATE, ZIP _____

OPERATOR _____

STREET ADDRESS _____

CITY, STATE, ZIP _____

Inspection Status

(Check one)

☐

F.A.R. 91.409 ANNUAL/100 HOUR

☐

F.A.R. 91.409 PROGRESSIVE

☐

F.A.R. 135.419 A.T.C.O.

☐

OTHER

DATE ENTERED _____

MAINTENANCE RESPONSIBILITY

HARTSELL AVIONICS INC. 325 CORPRATE ROAD LONGVIEW, TEXAS 75603 H9TR858J

LOG ID# 111 15-June-2018 WO# 8609/1

N1268Z S/N tc84 BEECH 95-55


Pg 1 / 1

**** ITEM # 8609-2 BIENNIAL TRANSPONDER CERTIFICATION ****

DISCREPANCY: BIENNIAL TRANSPONDER CERTIFICATION

Model: KT76A Part#: 066-1062-00 Serial#: 116175

ACTION: PRELIMINARY INSPECTION OKAY. BIENNIAL TRANSPONDER. THE ATC TRANSPONDER WAS TESTED AND INSPECTED IAW FAR 43 APPD F AND FOUND TO COMPLY WITH FAR 91.413. ALSO IAW FAR 43 APPD E PARA C.

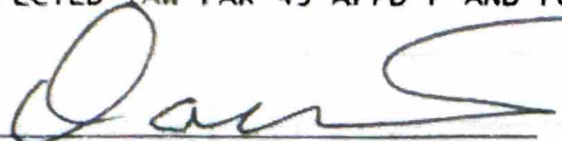
H9TR858J DAVID HARTSELL


THE ATC TRANSPONDER WAS TESTED

AND INSPECTED IAW FAR 43 APPD.F

AND FOUND TO COMPLY WITH FAR

91.413 MODEL KT76A S# 116175

N. O. # 1609 DATE 6-15-18

INSPECTOR 

HARTSELL AVIONICS, INC.

CRS H9TR858J TYLER, TX

ENGINE

ENGINE

PROPELLER


PROPELLER

DATE

N1268Z 5/21/2018 861.8 Hobbs, 6187.8 TT. All necessary panels opened for inspection. Aircraft lubricated as required by applicable maintenance manual. All Ads checked for compliance. See new AD compliance report prepared & added to aircraft maintenance records for details on AD compliance. Inspect & bleed brakes. Repair & reseal Rt. Master cylinder. Installed new fuel cap o-rings. Installed new BA7605 Air filter elements. Repaired stripped out screws on Left landing light. Repaired faulty main power connection on Rt. alternator & tensioned belt. Installed new ELT batteries. ELT operationally tested in accordance with FAR 91.207(d). NEW ELT BATTERY REPLACEMENT DATE 5/2020.
I CERTIFY THAT I HAVE INSPECTED THIS AIRCRAFT IN ACCORDANCE WITH AN ANNUAL INSPECTION & THAT IT IS IN AN AIRWORTHY CONDITION.

PATRICIA RAY BURCH

AP 3524230 IA

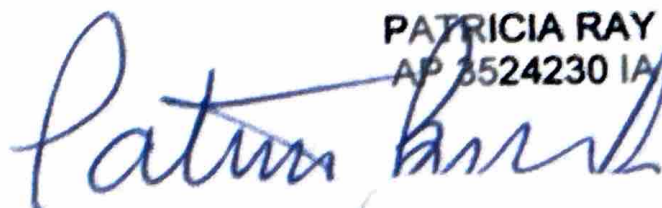

PDG Services + 670 Ferris Rd., Ste. 104 + Lancaster, TX. 75146

ACFT REG. N1268Z

TIME

The transponder system has been inspected and found to comply with the requirements of FAR 91.413. Pertinent details of the certification are on file at this repair station under the work order # 20-0138, dated 1-29-20

Transponder P/N

153010-000050

S/N

080121


Paul Gardner
CRS G49R038Y

(Authorized Signature)


214-886-5894

1-29-20

(Date)

N1268Z 2/20/2020 876 Hobbs, 6202 TT. All necessary panels opened for inspection. Aircraft lubricated as required by applicable maintenance manual. All Ads checked for compliance. See new AD compliance report prepared & added to aircraft maintenance records for details on AD compliance. Installed Appareo 1090 ESG Transponder with Stratus 3i ADS-B in and Stratus power port, Dual G5 indicators with GAD29B and GMU-11 and EIC CGR-30P Primary engine instrument system. See FAA forms 337 dated 1/17/2020 for additional details. Installed new LMLG tire & tube. Installed new lower flashing beacon unit. Repaired Rt. cowl flap. Removed vacuum system. Repaired engine baffle seals. ELT operationally tested in accordance with FAR 91.207(d).

I CERTIFY THAT I HAVE INSPECTED THIS AIRCRAFT IN ACCORDANCE WITH AN ANNUAL INSPECTION & THAT IT IS IN AN AIRWORTHY CONDITION.

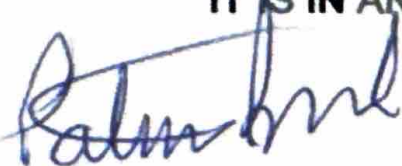


PATRICIA RAY BURCH
AP 3524230 IA

N 1268Z Date: 2/20/2020 Hobbs: 876.0
New A/C Empty Weight New A/C Empty Weight CG

3254

177.81


I certify that this aircraft Weight and Balance has been performed as equipped on this date.

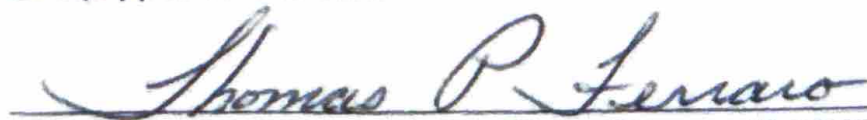

Thomas P Ferraro A&P 2095833 IA

N1268Z 5/13/2021 890 Hobbs, 6216 TT. All necessary panels opened for inspection. Aircraft lubricated as required by applicable maintenance manual. All Ads checked for compliance. See new AD compliance report prepared & added to aircraft maintenance records for details on AD compliance. Repaired Rt. cowl flap motor. Replaced 2 oil pressure hoses. ELT operationally tested in accordance with FAR 91.207(d). Removed both Plane Power alternators because of broken mounts. Installed Plane power approved replacement mounts. I CERTIFY THAT I HAVE INSPECTED THIS AIRCRAFT IN ACCORDANCE WITH AN ANNUAL INSPECTION & THAT IT IS IN AN AIRWORTHY CONDITION.

PATRICIA RAY BURCH
AP 35242301A

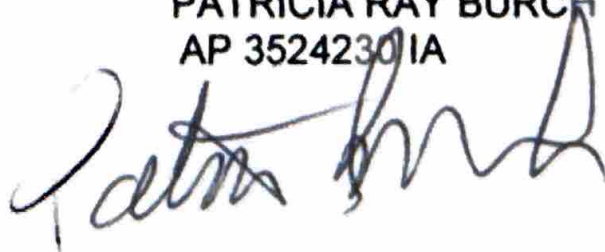

NTS

AGENCY
CERT. NO.

wo: WO_45

Airframe · page 1 of 1



East Texas Flying Services · 321 County Rd 2355 · Mineola, TX 75773 · 888-369-5080

N1268Z

Beechcraft, 95-55, S/N: TC-84

August 22, 2025

HOBBS: 893.9

TTSN: 6219.9

1. Remove panels, covers, and interior, to facilitate inspection.
2. Perform lube of all joints and hinges IAW MM.
3. Inspect all wheel bearings and pack with grease.
4. Complied with AD 2007-08-08 Landing gear uplock rollers.
5. troubleshooting GNS 530 R&R after after sending to shop for repair. Removed, Sent Out, Reinstalled P/N 011-00550-10 - Garmin GNS 530 S/N: 78403463.
6. R&R L/H brake caliper O-rings Installed (2) P/N MS28775-222 - O-Ring.
7. R&R ELT Batteries. Batteries good till 06/27. ELT operationally tested in accordance with FAR 91.207(d). Installed (6) P/N D Cell Batt - D cell battery.
8. Repaired ignition wire on R/H engine Installed P/N EA-4060 - Spark plug spring.
9. R&R R/H MLG tire and tube Installed P/N 072-364-0 - Michelin Condor Tire 6.50-8 8Ply, Installed P/N GL-6515B - Leak-Guard Tube 650/700-8.
10. R&R front and aft baggage door locks.

I certify that I have inspected this aircraft in accordance with an annual/100hr. Inspection & that it is in an airworthy condition.

Samuel Schatte A&P IA 3660575

A handwritten signature in cursive script, reading "Samuel Schatte", written over a horizontal line.