

N8442H

1981 Piper PA-32-301

Prop Logbook SPOH | #2 of 2 2017 - 2024

MSN: 32-8106098



Prepared by the worldwide aviation specialists at RidgeAire, Inc.



The Standard

PROPELLER LOG

ASA-SP-L

HUB & BLADE INSPECTIONS, REPAIRS AND ALTERATIONS

Year

Date

Next
Due:

Total Time
in Service

Description

Next
Due:


Sky Warrior
Maintenance

4141 Jerry Maygarden Rd
Pensacola, FL 32504
850-433-6116

Year:

Date

Next
Due:

02/17/2017 N8442H - Piper 32-301 S/N: 32-8106098 TACH: 1679.2 AFTT: 5617.8

McCauley: B3D36C433-C S/N: 040819 PTT: 1931.7 PTSMOH: 1931.7


- 1-Removed prop spinner and inspected - no defects
- 2-Inspected spinner bulkhead - no defects
- 3-Inspected propeller - no defects
- 4-Reinstalled spinner

Year:

Date:

Next
Due:

I certify this PROPELLER was inspected IAW a 100 HOUR / ANNUAL INSPECTION as per FAR 43 and has been determined to be in airworthy condition in regards to the work performed. Pertinent details of this maintenance action can be found under W/O 34416-1.


Brendan Doherty
3584465 A&P/IA

Date: 04/27/2020 **Hours:** Tach: 1966.07 AFTT: 5905.8

Year: **Tail#:** N8442H

Date: **Make:** Piper **Model:** PA-32-301 **S/N:** 32-8106098

Next Due: Removed spinner and performed a 100hrs propeller inspection referencing Piper MM P/N (761-721) dated Oct, 31 2019. and the scope and details of Far 43 Appendix D.

Removed prop and installed Alternator belt P/N 37A19773-376 and tensioned.

Reinstalled prop with new prop O-ring P/N A1633-11, torqued prop bolts to 55 ft/lb and saftied. Dressed prop. performed AD search. Reinstalled spinner. Run up and leak check OK.

Year:
Date:

Next Due:

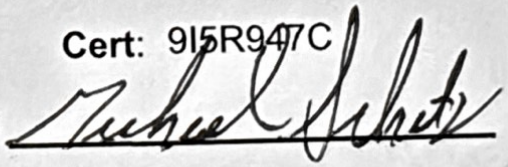
Year:
Date:

Next Due:

Name: Canyon Aero LLC

Co: Canyon Aero LLC

Cert: 915R947C

Sign: 

Date: 04/21/2020 Hours: Tach: 1966.7 PTT: 5905.8 SMOH: 667.0

AIRS AND ALTERATIONS

Tail#: N8442H

Make: Piper

Model: PA-32-301

S/N: 32-8106098

Year:

Date:

Next Ins Due:

I certify this propeller has been inspected IAW a 100 hr/annual inspection referencing Piper Maintenance Manual P/N 761-721 effective 10/31/2019 and FAR 43 appendix D and determined it to be in an airworthy condition at this time.

Year:

Date:

Next Ins Due:

Year:

Date:

Next Ins Due:

Name: Canyon Aero LLC

Co: Canyon Aero LLC

Cert: 915R947C

Sign: Craig A. Mussen

Aero-Tech Services, Inc. 500-P Airport Road Lititz, PA 17543

Make: PIPER

Date: 04/23/21

Propeller Log

Model: PA-32-301

S/N: 32-8106098

Type: B3D36C433C

Total Time: 5963.1

Reg. No.: N8442H

Tach Time: 2024.50

S/N: 040819

SOH: 724.5

- Completed 100 hour inspection items.

I CERTIFY THAT THIS PROPELLER HAS BEEN INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION AND HAS BEEN DETERMINED TO BE IN AIRWORTHY CONDITION.



Date: April 23, 2021

Signed:

Robert G. Zimmerman

Cert. No. AP3129806IA

Page 1 of 1

Next Inspection Due:

Time Since Overhaul

8-10-2022 N8442H Log: Prop Tach: 2059.0 smoh: 759.0 TT: 5997.6

Maintenance completed by Cherryhill Aviation Inc.

I certify this propeller was inspected in accordance with an annual inspection and completed at this date. Inspected Propeller in accordance with FAR 43 App. D; per owner's request; using Piper check list as additional guidance All AD's complied with at this date using T-data see attached AD copy for details. All continued airworthiness checked. Aircraft found to be airworthy on this date.

Year:

Date:

Dakota Garlick A&P/I.A. 3621331

Next Inspection Due:

Time Since Overhaul

Mech. Cert. # or Repair Station #

Maintenance completed by Cherryhill Aviation Inc.

9-1-2023 N8442H Log: Prop Tach: 2070.6 smoh: 770.6 TT: 6009.2

-Replaced spinner front support part number C4383 and added shims as needed and reinstalled spinner.

I certify this propeller was inspected in accordance with an annual inspection and completed at this date. Inspected Propeller in accordance with CFR 14 appendix D to part 43; per owner's request; using Piper check list as additional guidance All AD's complied with at this date using T-data see attached AD copy for details. All continued airworthiness checked. Aircraft found to be airworthy on this date.

~~_____~~
Dakota Garlick A&P/I.A. 3621331

Ne
Due: _____
Mech. Cert. # or Repair Station # _____

Year: _____	Total Time in Service	Description
Date: _____		
Next Inspection Due: _____	Time Since Overhaul	Mech. Cert. # or Repair Station # _____

Year: _____	Total Time in Service	Description
Date: _____		
Next Inspection Due: _____	Time Since Overhaul	Mech. Cert. # or Repair Station # _____

